Avellana Solar and Broadband Project February 2023

U.S. Dept. of Agriculture Rural Utilities Service


Environmental Assessment

APPENDIX - A

LAND USE




U.S. Department of Agriculture Rural Utilities Service (RUS)

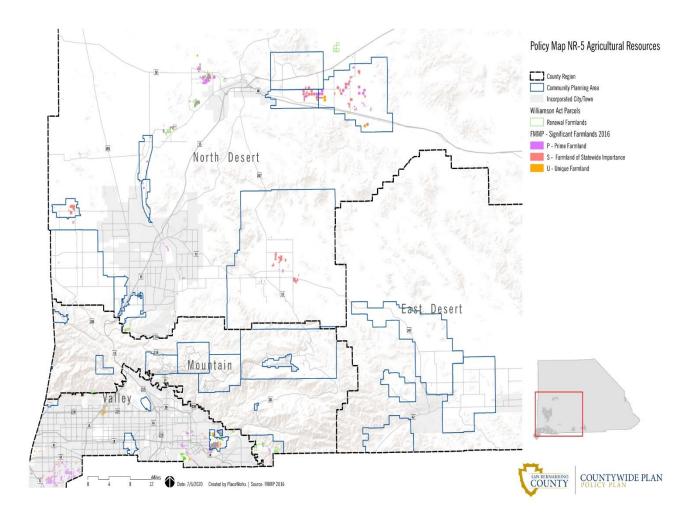

SAN BERNARDINO COUNTYWIDE PLAN POLICY PLAN, POLICY MAP NR-5

The County of San Bernardino General Plan Countywide Plan Policy Map NR-5 Agricultural Resources shows the site as being within the County Region and outside of any FMMP – Significant Farmlands 2016 as listed on the Policy Map as "Prime Farmland, Farmland of Statewide Importance and Unique Farmland".

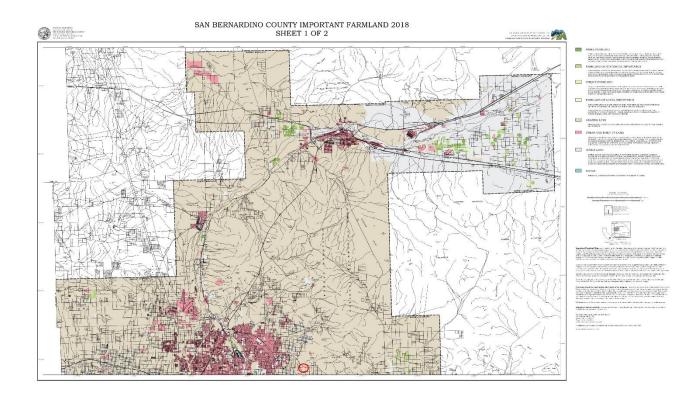


PRIME FARMLAND
PRIME PARMEAND HAS THE REST COMBINATION OF PROSTAL AND

- Index Tablecard Index The East Constitution of Press And Ontonia, Institute COLUME, Section 2014, Se
- VARIAGEN OF OTHER REPORTED TO THE ADDRESS OF THE ADDRESS OF THE OTHER OF THE OTHER OF THE OTHER ADDRESS OF THE ADDRESS OF THE
- UNINGUE PERMILIARID UNINGUE PERMILIARID INSTITUE LIABORIA ACTIONITIONI, LIABUE GUILATA DOLLA UNINGUE FOR THE HIGGLICTION OF THIS STATES LIABORIA ACTIONITIONI, LIADIE, LIADIE LIADIE LIADIE LIADIE LIADIE DOLLATIENTE INCLUIDIENT, LIADIE LIADIE LIADIE LIADIE CONTRUCT IN CONTRUMENT INCLUIDIENT, LIADIE LIADIE LIADIE LIADIE CONTRUCT INTE DEI DOLLATIE HIGGLI TO DE LIADIED DELLE
- PARMLAND OF LOCAL IMPORTANCE
 PAREARM VIEW SHALL BE ALL THE CHARACTERISTS
 PAREARM VIEW SHALL BE AREA OF ROLL THAT HALT HE CHARACTERISTS
 PAREARMS VIEW SHALL BE AND ALL THAT ALL THE CHARACTERISTS
 PAREARMS IN CONSTST IN ADDITION OF THE ALL THAT ALL THE CHARACTERISTS
 PAREARMS INCOMENTS IN ADDITION OF THE ALL THAT ALL THE CHARACTERISTS
 PAREARMS INCOMENTS IN ADDITION OF THE ALL THAT ALL THE CHARACTERISTS
 PAREARMS INCOMENTS IN ADDITION OF THE ALL THAT ALL THE CHARACTERISTS
 PAREARMS INCOMENTS IN A DITION OF THE ALL THAT ALL THE CHARACTERISTS
 PAREARMS INCOMENTS IN A DITION OF THE ALL THAT AL
- GRAZING LAND GRAZING LAND IS LAND ON WHICH THE CAMPTER VIOLETATION IS SUFFED TO TH OF LIPERTOCK.
- URBAN AND BUILT-UP LAND




INA. WATER BODIES WITH AN EXTENT OF AT LEAST 40 ACRESS



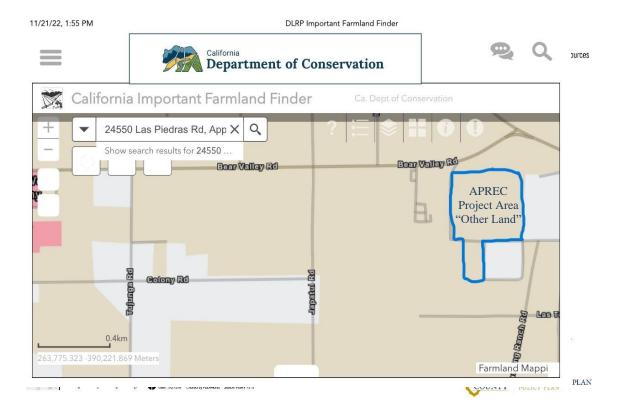


The Calfornia Department of Conservation Division of Land Resource Protection (DLRP) provides an online mapping tool to help identify Important Farmland areas within the state. In the DLRP Important Farmland identifier tool shown above the APREC project area is depicted within the blue-bordered area. The project area does not lie within a DLRP-Important Farmland designated area.

Farmland Classification—San Bernardino County, California, Mojave River Area

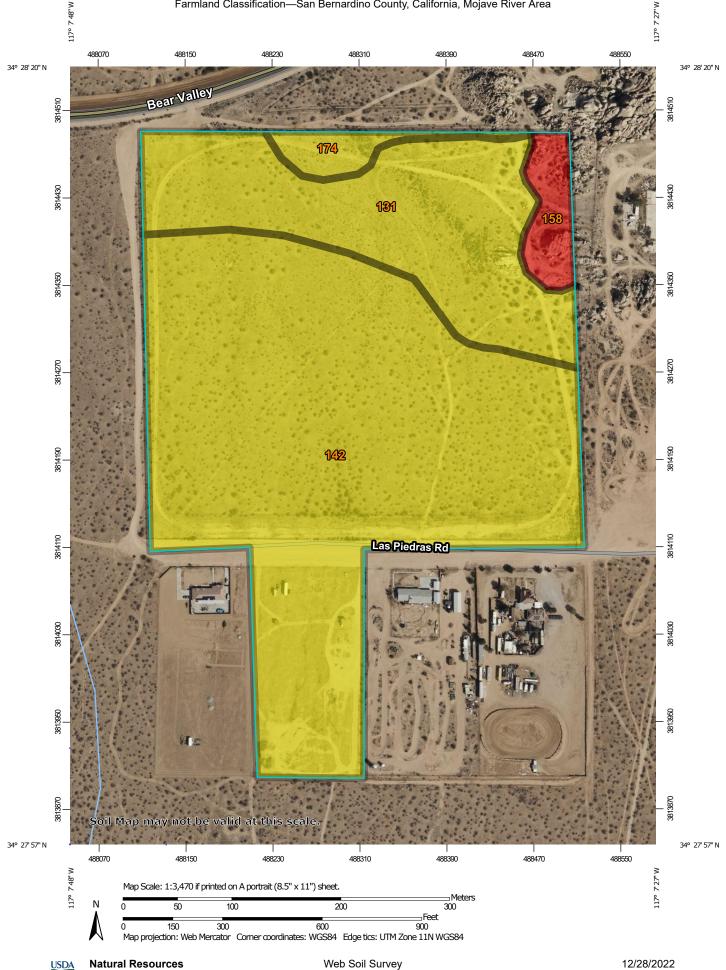

National Cooperative Soil Survey

Conservation Service

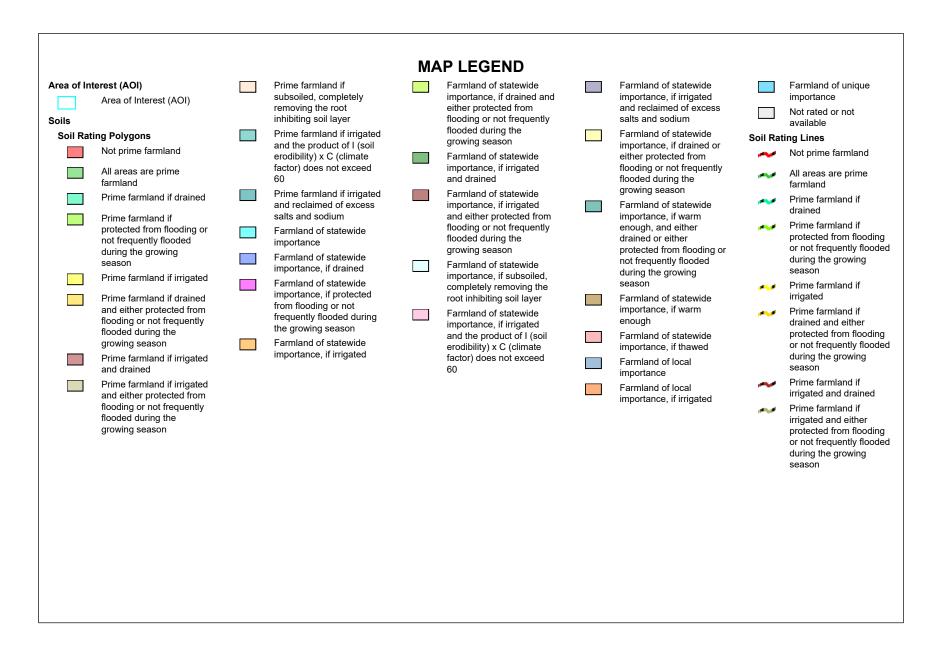

- Prime farmland if subsoiled, completely removing the root inhibiting soil layer
- Prime farmland if irrigated and the product of I (soil erodibility) x C (climate factor) does not exceed 60
- Prime farmland if irrigated and reclaimed of excess salts and sodium
- Farmland of statewide importance
- Farmland of statewide importance, if drained
- Farmland of statewide importance, if protected from flooding or not frequently flooded during the growing season
- Farmland of statewide importance, if irrigated

- Farmland of statewide importance, if drained and either protected from flooding or not frequently flooded during the
- growing season Farmland of statewide importance, if irrigated and drained

100

- Farmland of statewide importance, if irrigated and either protected from flooding or not frequently flooded during the growing season
 Farmland of statewide importance, if subsoiled.
- completely removing the root inhibiting soil layer

importance, if irrigated and the product of I (soil erodibility) x C (climate factor) does not exceed 60

- Farmland of statewide importance, if irrigated and reclaimed of excess salts and sodium
- Farmland of statewide importance, if drained or either protected from flooding or not frequently flooded during the growing season
- Farmland of statewide importance, if warm enough, and either drained or either protected from flooding or not frequently flooded during the growing season
- Farmland of statewide importance, if warm enough
- Farmland of statewide importance, if thawed
- Farmland of local importance
- Farmland of local importance, if irrigated

- Farmland of unique importance Not rated or not available Soil Rating Points
 - Not prime farmland
 - All areas are prime farmland
 - Prime farmland if drained
 - Prime farmland if protected from flooding or not frequently flooded during the growing season
 - Prime farmland if irrigated
 - Prime farmland if drained and either protected from flooding or not frequently flooded during the growing season
 - Prime farmland if irrigated and drained
 - Prime farmland if irrigated and either protected from flooding or not frequently flooded during the growing season

- Prime farmland if subsoiled, completely removing the root inhibiting soil layer
- Prime farmland if irrigated and the product of I (soil erodibility) x C (climate factor) does not exceed 60
- Prime farmland if irrigated and reclaimed of excess salts and sodium
- Farmland of statewide importance
- Farmland of statewide importance, if drained
- Farmland of statewide importance, if protected from flooding or not frequently flooded during the growing season
- Farmland of statewide importance, if irrigated



	Farmland of statewide importance, if drained and either protected from		Farmland of statewide importance, if irrigated and reclaimed of excess		Farmland of unique importance Not rated or not available	The soil surveys that comprise your AOI were mapped at 1:24,000.
	flooding or not frequently flooded during the		salts and sodium Farmland of statewide	⊔ Water Fea		Warning: Soil Map may not be valid at this scale.
	growing season Farmland of statewide		importance, if drained or either protected from	\sim	Streams and Canals	Enlargement of maps beyond the scale of mapping can cause misunderstanding of the detail of mapping and accuracy of soil
-	importance, if irrigated and drained		flooding or not frequently flooded during the	Transport		line placement. The maps do not show the small areas of
	Farmland of statewide		growing season	•••	Rails	contrasting soils that could have been shown at a more detailed scale.
-	importance, if irrigated and either protected from		Farmland of statewide importance, if warm	~	Interstate Highways	
	flooding or not frequently		enough, and either	~	US Routes	Please rely on the bar scale on each map sheet for map measurements.
	flooded during the growing season		drained or either protected from flooding or	\sim	Major Roads	
	Farmland of statewide		not frequently flooded during the growing	~	Local Roads	Source of Map: Natural Resources Conservation Service Web Soil Survey URL:
	importance, if subsoiled, completely removing the		season	Backgrou	nd	Coordinate System: Web Mercator (EPSG:3857)
	root inhibiting soil layer Farmland of statewide importance, if irrigated and the product of I (soil erodibility) x C (climate factor) does not exceed 60		Farmland of statewide	Farmland of statewide	Aerial Photography	Maps from the Web Soil Survey are based on the Web Mercato
		anaugh			projection, which preserves direction and shape but distorts	
			Farmland of statewide			distance and area. A projection that preserves area, such as th Albers equal-area conic projection, should be used if more
		 importance, if thawed Farmland of local importance Farmland of local importance, if irrigated 	, , , , , , , , , , , , , , , , , , ,			accurate calculations of distance or area are required.
					This product is generated from the USDA-NRCS certified data	
					as of the version date(s) listed below.	
			importance, il imgated	Soil Survey	Soil Survey Area: San Bernardino County, California, Mojave	
		Soil map units ar				River Area Survey Area Data: Version 14, Sep 1, 2022
						Soil map units are labeled (as space allows) for map scales
			1:50,000 or larger.			
					Date(s) aerial images were photographed: Mar 17, 2022—Jur 12, 2022	
						The orthophoto or other base map on which the soil lines were compiled and digitized probably differs from the background imagery displayed on these maps. As a result, some minor shifting of map unit boundaries may be evident.



Farmland Classification

Man unit aumhal	Man unit name	Detine		
Map unit symbol	Map unit name	Rating	Acres in AOI	Percent of AOI
131	HELENDALE LOAMY SAND, 0 TO 2 PERCENT SLOPES	Prime farmland if irrigated	10.8	25.2%
142	LUCERNE SANDY LOAM, 0 TO 2 PERCENT SLOPES	Prime farmland if irrigated	29.6	68.9%
158	ROCK OUTCROP- LITHIC TORRIORTHENTS COMPLEX, 15 TO 50 PERCENT SLOPES*	Not prime farmland	1.4	3.3%
174	WASCO SANDY LOAM, COOL, 2 TO 5 PERCENT SLOPES	Prime farmland if irrigated	1.1	2.5%
Totals for Area of Inter	est		42.9	100.0%

Description

Farmland classification identifies map units as prime farmland, farmland of statewide importance, farmland of local importance, or unique farmland. It identifies the location and extent of the soils that are best suited to food, feed, fiber, forage, and oilseed crops. NRCS policy and procedures on prime and unique farmlands are published in the "Federal Register," Vol. 43, No. 21, January 31, 1978.

Rating Options


Aggregation Method: No Aggregation Necessary

Tie-break Rule: Lower

National Flood Hazard Layer FIRMette



Legend

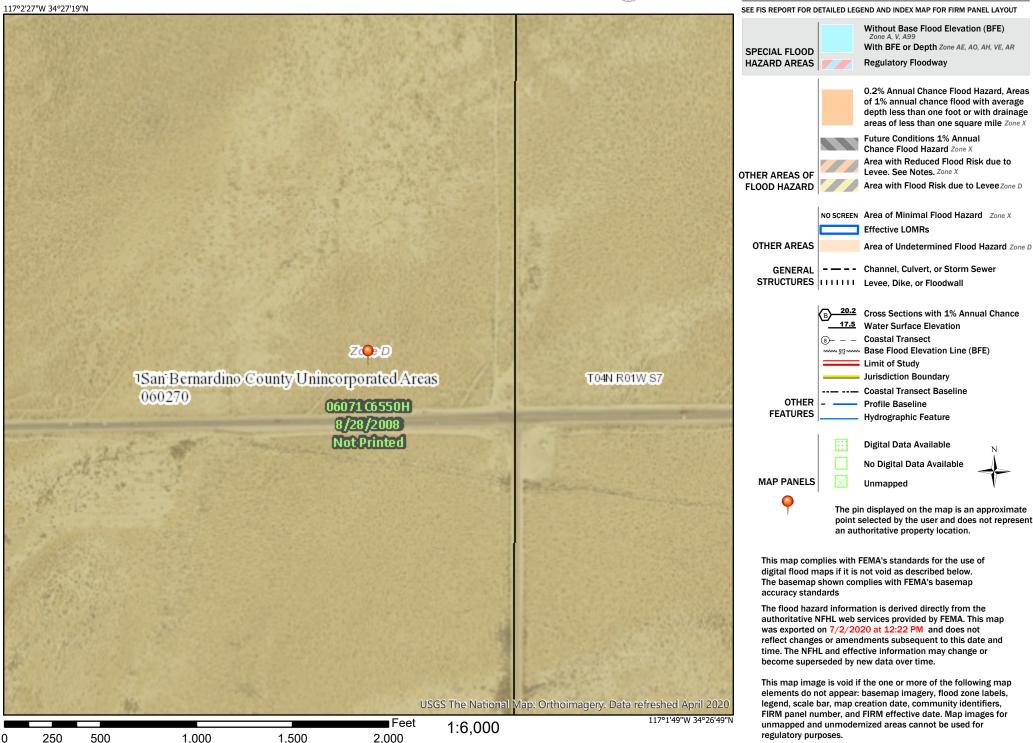

GEOTECHNICAL AND INFILTRATION EVALUATION PROPOSED MOBILE HOME PARK Assessor's Parcel Numbers 0435-015-13 and -35 Apple Valley, San Bernardino County, California

PREPARED FOR

Avellana Properties, Inc. 6101 Owensmouth Avenue Woodland Hills, California 91365

PREPARED BY

GEOTEK, INC. 1548 NORTH MAPLE STREET CORONA, CALIFORNIA 92880

PROJECT NO. 2683-CR

March 29, 2021





March 29, 2021 Project No. 2683-CR

Avellana Properties, Inc.

6101 Owensmouth Avenue Woodland Hills, California 91365

Attention: Mr. David Weisman

Subject: Geotechnical and Infiltration Evaluation Proposed Mobile Home Park Assessor's Parcel Numbers 0435-015-13 and -035 Apple Valley, San Bernardino County, California

Dear Mr. Wesiman:

We are pleased to provide herein the results of our geotechnical and infiltration evaluation for the subject site located in Apple Valley, San Bernardino County, California. This report presents a discussion of our evaluation and provides preliminary geotechnical recommendations for earthwork, foundation design, and construction.

In our opinion, site development appears feasible from a geotechnical viewpoint provided that the recommendations included herein are incorporated into the design and construction phases of site development. The opportunity to be of service is sincerely appreciated. If you should have any questions, please do not hesitate to call our office.

Respectfully submitted, **GeoTek, Inc.**



Edul H. Let

Edward H. LaMont CEG 1892, Exp. 07/31/22 Principal Geologist

Amah. Scoto

Anna M. Scott Project Geologist

Distribution: (I) Addressee

G:\Projects\2651 to 2700\2683CR Avellana Properties, Inc. APN's 0435-015-13 & -035 Apple Valley\Geotechnical and Infiltration Evaluation\2683CR Geotechnical and Infiltration Evaluation Apple Valley.docx



Robert R. Russell GE 2042, Exp. 12/31/22 Senior Project Engineer



TABLE OF CONTENTS

١.	PU	RPOSE AND SCOPE OF SERVICES	I
2.	SIT	E DESCRIPTION AND PROPOSED DEVELOPMENT	I
	2.1	Site Description	
	2.2	Proposed Development	2
3.	FIE	LD EXPLORATION & LABORATORY TESTING	
5.	3.1	FIELD EXPLORATION	
	3.2	LABORATORY TESTING	
	3.3	Percolation Testing	
٨		OLOGIC AND SOILS CONDITIONS	
٦.	4.I	REGIONAL SETTING	
	4.2	General Soil/Geologic Conditions	
	т.2	4.2.1 Alluvium	
	4.3	Surface and Groundwater	
		4.3.1 Surface Water	
		4.3.2 Groundwater	
	4.4	Faulting and Seismicity	6
		4.4.1 Seismic Design Parameters	
	4.5	LIQUEFACTION CONSIDERATIONS	
	4.6	Other Seismic Hazards	
5.	со	NCLUSIONS AND RECOMMENDATIONS	8
	5.I	GENERAL	8
	5.2	Earthwork Considerations	8
		5.2.1 Site Clearing	
		5.2.2 Site Preparation	
		5.2.3 Fills 5.2.4 Excavation Characteristics	
		5.2.5 Shrinkage/Bulking Estimates	
		5.2.6 Trench Excavations and Backfill	10
	5.3	Design Recommendations	
		5.3.1 Miscellaneous Foundation Recommendations	13
	5.4	5.3.2 Foundation Setbacks Retaining Wall Design and Construction	
	Ј.т	5.4.1 General Design Criteria	
		5.4.2 Cantilevered Walls	
		5.4.3 Restrained Retaining Walls	15
		5.4.4 Retaining Wall Backfill and Drainage	
	5.5	Soil corrosivity	
		5.5.1 Soil Sulfate Content	
	5.6	5.5.2 Import Soils PRELIMINARY PAVEMENT DESIGN	
	5.0 5.7	Concrete Flatwork	
	5.7	Post Construction Considerations	
	5.0	5.8.1 Landscape Maintenance and Planting	
		J.O. I Lundscupe Munitenunce und Fluinung	7



TABLE OF CONTENTS

	гo	5.8.2 Drainage Plan Review and Construction Observations	19
	5.7	PLAN REVIEW AND CONSTRUCTION OBSERVATIONS	20
6.	ΙΝΤ	۲ENT	20
7.	LIM	IITATIONS	21
8.	SEL	ECTED REFERENCES	21

ENCLOSURES

<u>Figure 1</u> – Site Location and Topography Map <u>Figure 2</u> – Boring Location Map
<u>Appendix A</u> – Logs of Exploratory Borings <u>Appendix B</u> – Laboratory Test Results <u>Appendix C</u> – Infiltration Test Data
<u>Appendix D</u> – Seismic Settlement Analysis <u>Appendix E</u> – General Grading Guidelines



I. PURPOSE AND SCOPE OF SERVICES

The purpose of this study was to complete an updated evaluation of the existing geotechnical conditions at the project site, as outlined in our proposal P-0209421-CR, dated March 2, 2021. Services provided for this study included the following:

- Research and review of available geologic and geotechnical data, and general information pertinent to the site,
- Perform a site reconnaissance,
- Site exploration consisting of the excavation and sampling of six exploratory borings observed and logged by a geologist from our firm,
- Excavation of four additional shallow borings for infiltration testing and performance of percolation testing in each of these borings,
- Collection of representative soil samples from the test borings and performing laboratory testing on select samples,
- Review and evaluation of site seismicity, and
- Compilation of this updated geotechnical report which presents our recommendations for site development.

2. SITE DESCRIPTION AND PROPOSED DEVELOPMENT

2.1 SITE DESCRIPTION

The approximate 45-acre site is located south of Bear Valley Road between Japatul Road to the west and Laguna Seca Drive to the east in Apple Valley. The site consists of two separate but adjacent parcels. The 40.2 acre site (APN 0435-015-13) consists of vacant and undeveloped land. The 4.72-acre parcel (APN 0435-015-035) is located to the south of the 40.2 acre site and is occupied by three structures and storage areas. Most of the site slopes gently downward to the north but small hills are situated within/adjacent to the northeast corner of the site. The location of the site is indicated on Figure 1.



2.2 PROPOSED DEVELOPMENT

We understand that site development will consist of a 402-unit mobile home park that will also include a club house, a market, a medical office building, a small lake, a park/basin, storm water facilities and associated roadways. The development is planned within the 40.2 acre parcel and the southerly adjacent 4.72 acre parcel will be used for stormwater management.

We have assumed that the permanent structures will consist of single-story buildings and will be supported by conventional shallow foundations and will incorporate a slab on-grade follr systems. Although structural loading information has not been provided, we have assumed maximum column and wall laods of less than 50 kips and 3 kips per foot, respectively. It is also assumed that the medical office building will not be under the view of OSHPD. Once actual structural loads are known, that information should be provided to GeoTek to determine if revisions to the recommendations presented in this report are warranted.

Based on the current site topography, we anticipate that the maximum depths of cut and fill will be less than about 5 feet, not including any remedial grading. If site development differs from the assumptions made herein, the recommendations included in this report should be subject to further review and evaluation. Site development plans should be reviewed by GeoTek when they become available.

3. FIELD EXPLORATION & LABORATORY TESTING

3.1 FIELD EXPLORATION

The field exploration for GeoTek's evaluation was conducted on March 8, 2021 and consisted of excavating six (6) geotechnical exploratory borings extended to depths ranging from about 12 to $51-\frac{1}{2}$ feet below ground surface. One of the borings was terminated at a depth shallower than planned due to refusal on possible cobbles or boulders. Four shallow borings were also drilled to depths of about 5 feet for percolation testing. The approximate locations of the GeoTek excavations are shown on the Boring Location Map (Figure 2). Logs of the GeoTek borings are included in Appendix A.

Relatively undisturbed soil samples were recovered at various intervals in the geotechnical borings with a California sampler. The California sampler is a 3-inch outside diameter, 2.4-inch inside diameter, split barrel sampler lined with brass rings. The sampler was 18 inches long. The sampler conformed to the requirements of ASTM D 3550. A 140-pound automatic trip hammer



was utilized, dropping 30 inches for each blow. The relatively undisturbed samples, together with bulk samples of representative soil types, were returned to the laboratory for testing and evaluation. The California ring sampler data is presented on the boring logs.

3.2 LABORATORY TESTING

Laboratory testing was performed by GeoTek on selected soil samples obtained from the borings. The purpose of the laboratory testing was to confirm the field classification of the soils encountered and to evaluate the physical properties of the soils for use in engineering design and analysis.

Included in our laboratory testing were moisture-density determinations and collapse testing on selected relatively undisturbed samples. The optimum moisture content-maximum dry density relationship was established for typical soil types so that the relative compaction of the subsoils could be determined. Direct shear testing was performed on selected samples to help evaluate the bearing capacity of the soils. Expansion index testing was performed on three selected sample to evaluate the expansion potential of the site soils. Chemical testing comprised of pH, soluble sulfate, chloride and resistivity testing was conducted on selected samples. The moisture-density data is presented on the exploration logs in Appendix A. The maximum density, direct shear, collapse tests, expansion index and chemical test data are presented in Appendix B.

3.3 PERCOLATION TESTING

Percolation testing was performed at boring locations I-1 through I-4 to assess the infiltration characteristics of the site soils within the future stormwater management basin. These borings were excavated to approximately 5 feet below the existing grade. The boring diameter was approximately eight inches. Subsequent to pre-soaking, percolation testing was performed within the lower approximately 20 inches in the borings. The percolation rates were then corrected to account for discharge of water from both the sides and bottom of the borings. This correction was performed using the Porchet Method, obtaining the infiltration rates tabulated below:



SUMMARY OF RESULTS				
Poring	Measured Field Percolation Rate	Calculated Infiltration Rate		
Boring	(minutes per inch)	(inches per hour)		
I- I	3.08	2.28		
I-2	3.0	2.35		
I-3	2.86	2.51		
I-4	2.92	2.43		

Copies of the field data sheets and infiltration conversion sheets (Porchet Method) are included in Appendix C. The reported infiltration rate is the measured rate without any factor of safety applied. Over the lifetime of the detention basin, the infiltration rates may be affected by silt build up and biological activities, as well as local variations in near surface soil conditions. A suitable factor of safety should be applied to the field rates in design the infiltration system.

It should be noted that the infiltration rates provided above were performed in relatively undisturbed native soils. Infiltration rates will vary and are mostly dependent on the underlying consistency of the site soils and relative density. Infiltration rates will be impacted by weight of equipment travelling over the soils, placement of engineered fill and other various factors. GeoTek, Inc. assumes no responsibility or liability for the ultimate design or performance of the storm water facility.

4. GEOLOGIC AND SOILS CONDITIONS

4.1 REGIONAL SETTING

The property is situated in the Mojave Desert geomorphic province. The Mojave Desert province is a wedge-shaped area that is enclosed on the southwest by the San Andreas fault zone, the Transverse Ranges province and the Colorado Desert province, on the north and northeast by the Garlock fault zone, the Tehachapi Mountains and the Basin and Range province, and on the east by the Nevada and Arizona state lines, and the Colorado River. The area is dominated by broad alluviated basins that are mostly aggrading surfaces that are receiving non-marine continental deposits from the adjacent upland areas.

The primary fault zones of the area are found in the western half of the province and have a general northwest-southeast trend. These zones are the San Andreas, Helendale, Lenwood and Lockhart in the subject site vicinity. In addition to these major zones, there are numerous



secondary fault zones in the area and many smaller fault zones in the eastern half of the province. Many of the secondary fault zones in the province have a general east-west trend.

More specific to the subject property, the site is located in an area geologically mapped to be underlain by alluvium (USGS, 1973).

4.2 GENERAL SOIL/GEOLOGIC CONDITIONS

A brief description of the earth materials encountered below the site and within the area of anticipated construction is presented in the following section. Based on our field exploration, the area of anticipated improvements is underlain by alluvium.

4.2.1 Alluvium

Alluvium was encountered within each test boring excavated at the site and extended to the maximum depth explored. The alluvium encountered consisted of a medium dense to very dense silty sand and sand and a stiff to very stiff sandy silt.

According to the results of the laboratory testing performed on two samples of the near surface soils, the near surface soils have a "very low" expansion potential (EI=3 and 0) when tested and classified in accordance with ASTM D 4829. The test results are provided in Appendix B.

4.3 SURFACE AND GROUNDWATER

4.3.1 Surface Water

If encountered during the earthwork construction, surface water on this site is the result of precipitation or surface run-off from surrounding sites. Provisions for surface drainage will need to be accounted for by the project civil engineer.

4.3.2 Groundwater

Groundwater was not encountered within any of the GeoTek borings which extended to a maximum depth of about 50 feet below grade. A review of groundwater depth information noted on the State Department of Water Resources Water Data Library website indicates a depth to groundwater of about 150 to 200 feet below grade within wells in the site vicinity. Therefore, it is our opinion that the depth to the hydrostatic water table is in excess of 150 feet below grade.



It is possible that seasonal variations (temperature, rainfall, etc.) will cause fluctuations in the groundwater level. Additionally, perched water may be encountered at shallow depths following extensive rain events. If shallow perched water is encountered, we anticipate that it can be managed with conventional sump pumps.

4.4 FAULTING AND SEISMICITY

The geologic structure of the entire southern California area is dominated mainly by northwesttrending faults associated with the San Andreas system. The site is in a seismically active region. No active or potentially active fault is known to exist at this site nor is the site situated within an *"Alquist-Priolo"* Earthquake Fault Zone. The subject property is not located within a State of California Seismic Hazard Zone for earthquake induced landsliding. The nearest zoned faults are then Helendale-South Lockhart fault, located about 5-1/2 miles to the northeast and the North Front Thrust fault system situated about 6 miles to the southeast.

4.4.1 Seismic Design Parameters

The site is located at approximately 34.4704 degrees Latitude and -117.1279 degrees Longitude. Site spectral accelerations (S_a and S_1), for 0.2 and 1.0 second periods for a Class "D" site, was determined from the SEAOC/OSHPD web interface that utilizes the USGS web services and retrieves the seismic design data and presents that information in a report format. Using the ASCE 7-16 option on the SEAOC/OSHPD website results in the values for S_{M1} and S_{D1} reported as "null-See Section 11.4.8" (of ASCE 7-16). As noted in ASCE 7-16, Section 11.4.8, a site-specific ground motion procedure is recommended for Site Class D when the value S_1 exceeds 0.2.

For a site Class D, an exception to performing a site-specific ground motion analysis is allowed in ASCE 7-16 where S₁ exceeds 0.2 provided the value of the seismic response coefficient, Cs, is conservatively calculated by Eq 12.8-2 of ASCE 7-16 for values of T≤1.5Ts and taken as equal to 1.5 times the value computed in accordance with either Eq. 12.8-3 for $T_L \ge T > 1.5Ts$ or Eq. 12.8-4 for T>T_L.

The results, based on the 2015 NEHRP and the 2019 CBC, are presented in the following table and we have assumed that the exception as allowed in ASCE 7-16 is applicable. If the exception is deemed not appropriate, a site-specific ground motion analysis will be required.



SITE SEISMIC PARAMET	TERS
Mapped 0.2 sec Period Spectral Acceleration, Ss	1.198g
Mapped 1.0 sec Period Spectral Acceleration, Si	0.449g
Site Coefficient for Site Class "D", Fa	1.021
Site Coefficient for Site Class "D", Fv	1.851
Maximum Considered Earthquake Spectral Response Acceleration for 0.2 Second, SMs	1.223g
Maximum Considered Earthquake Spectral Response Acceleration for I.0 Second, SMI	0.832g
5% Damped Design Spectral Response Acceleration Parameter at 0.2 Second, SDs	0.815g
5% Damped Design Spectral Response Acceleration Parameter at I second, SD1	0.554g
Peak Ground Acceleration Adjusted for Site Class Effects, PGA_M	0.563g
Seismic Design Category	D

4.5 LIQUEFACTION CONSIDERATIONS

A review of the San Bernardino County Geologic Hazard Maps indicates the site is not situated within an area that is designated as possessing a liquefaction hazard. Due to the current mapping and the great depth to groundwater (150+ feet), it is our opinion that the potential for liquefaction at this site due to nearby seismic activity is nil.

An assessment of the "dry' settlement (i.e. settlement above the water table) resulting from seismic shaking was also evaluated. For this analysis we used a groundwater depth of 150 feet, a ground acceleration (PGA_M) of 0.563g and an earthquake magnitude of 6.85. The ground acceleration and earthquake magnitude were obtained from the USGS websites. The computer software program LiquefyPro and the soil profiled from Boring B-2 were used in the analysis. The results of this analysis indicate a potential ground surface settlement of less than $\frac{1}{4}$ inch is possible. A differential seismic settlement of about 1/8 inch over a 40 foot span is also estimated. Based on these estimated magnitudes, ground modification or special foundation design is not deemed necessary. The results of the seismic dry settlement analysis are presented in Appendix D.

4.6 OTHER SEISMIC HAZARDS

Evidence of ancient landslides or slope instabilities at this site was not observed during our investigation. Thus, the potential for landslides is considered negligible for design purposes. The potential for secondary seismic hazards such as a seiche or tsunami is considered negligible due to site elevation and distance to an open body of water.



5. CONCLUSIONS AND RECOMMENDATIONS

5.1 GENERAL

Development of the site appears feasible from a geotechnical viewpoint. The following recommendations should be incorporated into the design and construction phases of development.

5.2 EARTHWORK CONSIDERATIONS

Earthwork and grading should be performed in accordance with the applicable grading ordinances of the City of Apple Valley/County of San Bernardino, the 2019 California Building Code (CBC) and recommendations contained in this report. Site grading plans should be reviewed by this office when they become available. Additional recommendations may be offered subsequent to review of these plans. The General Grading Guidelines included in Appendix E outline general procedures and do not anticipate all site-specific situations. In the event of conflict, the recommendations presented in the text of this report should supersede those contained in Appendix E.

5.2.1 Site Clearing

Initial site preparation should include removal of any existing improvements within the new development and vegetation and any other deleterious materials within the planned development area of the site. Removal of existing buildings should also include removal of all foundations and any other below-grade improvements. The horizontal limits of the clearing should extend at least 10 feet beyond the new buildings and beneath any new improvements.

Voids resulting from removing any materials should be replaced with engineered fill materials with expansion characteristics similar to the onsite materials.

5.2.2 Site Preparation

Due to the collapse potential of the near-surface soils, we recommend that the soil beneath new "permanent" structures (including retaining walls) be removed to a depth of at least three feet below existing or finished grade, whichever is deeper. The soils exposed at the base of the overexcavation should then be examined by a GeoTek representative to confirm that the exposed soils are suitable for structural support. If unsuitable soils are encountered, those materials should be removed as recommended by GeoTek. Once approved, the exposed soils should be scarified to a depth of about 12 inches, be moisture treated to slightly above the soil's maximum



dry density, per ASTM D1557, and then be compacted to at least 90% of the soil's maximum dry density (ASTM D1557).

Beneath new roadways, mobile home sites and pavements and following lowering of site grades, where necessary, we recommend that the existing soils be proof rolled in the presence of a GeoTek representative. Proof rolling equipment should possess a minimum static weight of 10 tons and proof rolling should consist of four passes, two in each perpendicular direction. Any soil that ruts or excessively deflects during proof rolling should be removed as recommended by the GeoTek representative.

5.2.3 Fills

On-site materials are generally considered suitable for reuse as engineered fill, provided they are free from vegetation, roots, and other deleterious material. Rock fragments greater than 6 inches in maximum dimension should not be incorporated into engineered fill.

Engineered fill materials should be placed in horizontal lifts not exceeding 8 inches in loose thickness, moisture conditioned to slightly over the optimum moisture content and compacted to a minimum relative compaction of 90 percent (ASTM D 1557).

5.2.4 Excavation Characteristics

Excavation in the on-site soils is expected to be feasible utilizing heavy-duty grading equipment in good operating condition. All temporary excavations for grading purposes and installation of underground utilities should be constructed in accordance with local and Cal-OSHA guidelines. Temporary excavations within the on-site materials should be stable at 1:1 (h:v) inclinations for cuts less than 5 feet in height.

5.2.5 Shrinkage/Bulking Estimates

Several factors will impact earthwork balancing on the site, including shrinkage, subsidence, trench spoil from utilities and footing excavations, as well as the accuracy of topography.

Shrinkage is primarily dependent upon the degree of compactive effort achieved during construction. For planning purposes, a shrinkage factor of approximately 5 to 10 percent may be considered for the materials requiring recompaction. Subsidence on the order of 0.1 feet may also occur.



5.2.6 Trench Excavations and Backfill

Temporary excavations within the onsite materials should be stable at 1:1 inclinations for short durations during construction, and where cuts do not exceed 10 feet in height. Temporary cuts to a maximum height of 4 feet can be excavated vertically, but local sloughing and/or failure could occur due to the granulated nature of the soils at this site. Increased caution should be applied when working near or within any excavations at this site.

Trench excavations should conform to Cal-OSHA regulations. The contractor should have a competent person, per OSHA requirements, on site during construction to observe conditions and to make the appropriate recommendations.

Utility trench backfill should be compacted to at least 90 percent relative compaction (as determined per ASTM D 1557). Under-slab trenches should also be compacted to project specifications. Onsite materials are not considered suitable for use as bedding material but should be suitable as backfill.

Compaction should be achieved with a mechanical compaction device. Ponding or jetting of trench backfill is not recommended. If backfill soils have dried out, they should be thoroughly moisture conditioned prior to placement in trenches.

5.3 **DESIGN RECOMMENDATIONS**

Foundation design criteria for a conventional foundation system, in general conformance with the 2019 CBC, are presented below. The soils are classified as having a "very low" expansion potential in accordance with ASTM D 4829. Typical design criteria for the site based upon a "very low" and expansion potentials are tabulated below. These are minimal recommendations and are not intended to supersede the design by the project structural engineer. Once structural loading information is provided, revisions to the recommendations provided in this report may be necessary.

The conventional foundation elements for the proposed permanent buildings should bear entirely in engineered fill soils. Foundations should be designed in accordance with the 2019 CBC.

Expansion index and soluble sulfate evaluation of the soils should be performed during construction to evaluate the as-graded conditions. Final recommendations should be based upon the as-graded soils conditions.



A summary of our foundation design recommendations is presented in the following table:

Design Parameter	"Very Low" to "Low" Expansion Potential
Foundation Depth or Minimum Perimeter Beam Depth (inches below lowest adjacent grade)	12
Minimum Foundation Width (Inches)*	12
Minimum Slab Thickness (actual)	4 – Actual
Minimum Slab Reinforcing	6" x 6" – WI.4/WI.4 welded wire fabric placed in middle of slab or No. 3 bars at 24 inch centers
Minimum Footing Reinforcement	Two No. 4 reinforcing bars, one placed near the top and one near the bottom
Effective Plasticity Index	PI<15
Presaturation of Subgrade Soil (Percent of Optimum)	Minimum of 100% of the optimum moisture content to a depth of at least 12 inches prior to placing concrete

GEOTECHNICAL RECOMMENDATIONS FOR FOUNDATION DESIGN

* Code minimums per Table 1809.7 of the 2019 CBC

An allowable bearing capacity of 1,500 pounds per square foot (psf) may be used for design of building foundations for footing depths and widths of 12 inches. This allowable soil bearing capacity can be increased by 700 psf and 250 psf for each additional foot of footing depth or width to a maximum value of 3,000 psf. The allowable bearing capacity may also be increased by one-third when considering short-term wind and seismic loads.

For footings designed in accordance with the recommendations presented in this report, we would anticipate a maximum static settlement of less than one inch and a maximum differential static settlement of less than $\frac{1}{2}$ -inch in a 40-foot span.

The passive earth pressure may be computed as an equivalent fluid having a density of 240 psf per foot of depth, to a maximum earth pressure of 3,000 psf for footings cast adjacent to competent fill or alluvium. A coefficient of friction between soil and concrete of 0.38 may be used with dead load forces. The upper one foot of soil below the adjacent grade should not be used in calculating passive pressure unless the ground surface is covered with pavement. When combining passive and frictional resistance, the passive pressure component should be reduced by one-third.

A moisture and vapor retarding system should be placed below slabs-on-grade where moisture migration through the slab is undesirable. Guidelines for these are provided in the 2019 California



Green Building Standards Code (CALGreen) Section 4.505.2 and the 2019 CBC Section 1907.1 and ACI 360R-10. The vapor retarder design and construction should also meet the requirements of ASTM E1643. A portion of the vapor retarder design should be the implementation of a moisture vapor retardant membrane.

It should be realized that the effectiveness of the vapor retarding membrane can be adversely impacted as a result of construction related punctures (e.g. stake penetrations, tears, punctures from walking on the aggregate layer, etc.). These occurrences should be limited as much as possible during construction. Thicker membranes are generally more resistant to accidental puncture than thinner ones. Products specifically designed for use as moisture/vapor retarders may also be more puncture resistant. Although the CBC specifies a six-mil vapor retarder membrane, it is GeoTek's opinion that a minimum 10 mil thick membrane with joints properly overlapped and sealed should be considered, unless otherwise specified by the slab design professional. The membrane should consist of Stego wrap or the equivalent.

Moisture and vapor retarding systems are intended to provide a certain level of resistance to vapor and moisture transmission through the concrete, but do not eliminate it. The acceptable level of moisture transmission through the slab is to a large extent based on the type of flooring used and environmental conditions. Ultimately, the vapor retarding system should be comprised of suitable elements to limit migration of water and reduce transmission of water vapor through the slab to acceptable levels. The selected elements should have suitable properties (i.e., thickness, composition, strength, and permeability) to achieve the desired performance level. Consideration should be given to consulting with an individual possessing specific expertise in this area for additional evaluation.

Moisture retarders can reduce, but not eliminate, moisture vapor rise from the underlying soils up through the slab. Moisture retarders should be designed and constructed in accordance with applicable American Concrete Institute, Portland Cement Association, Post-Tensioning Concrete Institute, ASTM and California Building Code requirements and guidelines.

GeoTek recommends that a qualified person, such as the flooring contractor, structural engineer, and/or architect be consulted to evaluate the general and specific moisture vapor transmission paths and associated potential impact.

In addition, the recommendations in this report and our services in general are not intended to address mold prevention, since we along with geotechnical consultants in general, do not practice in areas of mold prevention. If specific recommendations are desired, a professional mold prevention consultant should be contacted.



5.3.1 Miscellaneous Foundation Recommendations

- 5.3.1.1 To minimize moisture penetration beneath the slab on grade areas, utility trenches should be backfilled with engineered fill, lean concrete or concrete slurry where they intercept the perimeter footing or thickened slab edge.
- 5.3.1.2 Soils from the footing excavations should not be placed in the slab-on-grade areas unless properly compacted and tested. The excavations should be free of loose/sloughed materials and be neatly trimmed at the time of concrete placement.
- 5.3.1.3 Under-slab utility trenches should be compacted to project specifications. Compaction should be achieved with a mechanical compaction device. If backfill soils have dried out, they should be thoroughly moisture conditioned prior to placement in trenches.
- 5.3.1.4 Utility trench excavations should be shored or laid back in accordance with applicable CAL/OSHA standards.
- 5.3.1.5 On-site materials may not be suitable for use as bedding material but will be suitable as backfill. Jetting of native soils will not be acceptable.

5.3.2 Foundation Setbacks

Foundations should comply with the following setbacks. Improvements not conforming to these setbacks are subject to the increased likelihood of excessive lateral movements and/or differential settlements. If large enough, these movements can compromise the integrity of the improvements. The following recommendations are presented:

- The outside bottom edge of all footings should be set back a minimum of H/3 (where H is the slope height) from the face of any descending slope. The setback should be at least 7 feet and need not exceed 40 feet.
- The bottom of all footings for structures near retaining walls should be deepened so as to extend below a 1:1 projection upward from the bottom inside edge of the wall stem.
- The bottom of any existing foundations for structures should be deepened so as to extend below a 1:1 projection upward from the bottom of the nearest excavation.



5.4 RETAINING WALL DESIGN AND CONSTRUCTION

5.4.1 General Design Criteria

Recommendations presented in this report apply to typical masonry or concrete vertical retaining walls. These are typical design criteria and are not intended to supersede the design by the structural engineer.

Retaining wall foundations should be designed in accordance with Section 5.3 of this report. A minimum foundation embedment of 12 inches into engineered compacted fill with "very low" expansion potential is recommended. Structural needs may govern and should be evaluated by the project structural engineer.

All earth retention structure plans, as applicable, should be reviewed by this office prior to finalization.

The backfill material placement for all earth retention structures should meet the requirement of Section 5.4.4 in this report.

In general, cantilever earth retention structures, which are designed to yield at least 0.001H, where H is equal to the height of the wall to the base of the footing, may be designed using the active condition. Rigid earth retention structures (including but not limited to rigid walls, and walls braced at top, such as typical basement walls) should be designed using the at-rest condition.

In addition to the design lateral forces due to retained earth, surcharges due to improvements, such as an adjacent building or traffic loading, should be considered in the design of the earth retention structures. Loads applied within a 1:1 (h:v) projection from the surcharge on the stem of the earth retention structure should be considered in the design.

Final selection of the appropriate design parameters should be made by the designer of the earth retention structures.

5.4.2 Cantilevered Walls

The recommendations presented below are for cantilevered retaining walls. Active earth pressure may be used for retaining wall design, provided the top of the wall is not restrained from minor deflections. An equivalent fluid pressure approach may be used to compute the horizontal pressure against the wall. Appropriate fluid unit weights are given below for specific



slope gradients of the retained material. These do not include other superimposed loading conditions such as traffic, structures, seismic events, or adverse geologic conditions.

Surface Slope of Retained Materials	Equivalent Fluid Pressure (pcf)	
(h:v)	Native Backfill*	
Level	40	
* The design pressures assume the backfill material has an expansion index		

* The design pressures assume the backfill material has an expansion index less than or equal to 20. Backfill zone includes area between the back of the wall and footing to a plane (1:1 h:v) up from the bottom of the wall foundation to the ground surface.

5.4.3 Restrained Retaining Walls

Retaining walls that will be restrained prior to placing and compacting backfill material, or that have reentrant or male corners, should be designed for an at-rest equivalent fluid pressure of 60 pcf, plus any applicable surcharge loading, for very low expansive backfill (El<20) and level back slope condition. For areas of male or reentrant corners, the restrained wall design should extend a minimum distance of twice the height of the wall laterally from the corner, or a distance otherwise determined by the project structural engineer.

5.4.4 Retaining Wall Backfill and Drainage

Retaining wall backfill should consist of materials with an expansion index (EI) ≤ 20 and free of deleterious and/or oversized materials. The wall backfill should also include a minimum one-foot wide section of ³/₄- to 1-inch clean crushed rock (or approved equivalent). The rock should be placed immediately adjacent to the back of wall and extend up from the back drain to within approximately 12 inches of finish grade. The upper 12 inches should consist of compacted onsite materials or pavements. Presence of other materials might necessitate revision to the parameters provided and modification of wall designs. The backfill materials should be placed in lifts no greater than 8-inches in thickness and compacted to a minimum of 90 percent relative compaction in accordance with ASTM Test Method D 1557. Proper surface drainage needs to be provided and maintained. Bracing of the walls during backfilling and compaction may also be necessary.

All earth retention structures should be provided with an adequate pipe and gravel back drain system to reduce the potential for hydrostatic pressure build up. As a minimum, backdrains should consist of a four-inch diameter perforated collector pipe (Schedule 40, SDR 35, or approved equivalent) embedded in a minimum of one cubic foot per lineal foot of ³/₄- to 1-inch clean crushed rock or equivalent, wrapped in filter fabric (Mirafi 140N or approved equivalent). The drain system should be connected to a suitable outlet, as determined by the civil engineer. Drain outlets should be maintained over the life of the project and should not be



obstructed or plugged by adjacent improvements. Waterproofing of site walls should be performed where moisture migration through the wall is undesirable.

Proper surface drainage needs to be provided and maintained. Water should not be allowed to pond behind retaining walls. Waterproofing of site walls should be performed where moisture migration through the wall is undesirable.

5.5 SOIL CORROSIVITY

Based on the chemical test results performed on two samples collected from the site as presented in Appendix B, the corrosivity test results indicate that the on-site soils are "moderately corrosive" to "mildly corrosive" to buried ferrous metal. This corrosion classification is obtained from "Handbook of Corrosion Engineering," by Pierre R. Roberge, 2nd Edition, 2000. Recommendations for protection of buried ferrous metal should be provided by a corrosion engineer. Additional corrosion testing should be performed at the time of site grading to assess the corrosion of potential of the as-graded soils.

5.5.1 Soil Sulfate Content

The sulfate content was determined in the laboratory for two representative onsite soil samples. The results indicate that the water-soluble sulfate is less than 0.1 percent by weight which is considered "not applicable" (i.e. negligible) as per Table 4.2.1 of ACI 318. Based upon the test results, no special concrete mix design is required by Code for sulfate attack resistance.

5.5.2 Import Soils

Import soils (if needed) should have an Expansion Index of less than 20 (very low) and should not possess oversized or deleterious materials. GeoTek also recommends that, as a minimum, any proposed import soils be tested for soluble sulfate content. GeoTek should be notified a minimum of 72 hours of potential import sources so that appropriate sampling and laboratory testing can be performed.

5.6 PRELIMINARY PAVEMENT DESIGN

Preliminary pavement design for proposed street improvements was conducted per Caltrans *Highway Design Manual* guidelines for flexible pavements. Based on an assumed design R-value of 40 and for Traffic Indices (TIs) of 5.0 and 6.0, the following preliminary sections were calculated:



PRELIMINARY MINIMUM PAVEMENT SECTION				
Traffic Index	Thickness of Asphalt Concrete (inches)	Thickness of Aggregate Base (inches)		
5.0	3	4		
6.0	3-1/2	6		

Traffic Indices (TIs) used in our pavement design are considered reasonable values for the proposed residential street areas and should provide a pavement life of approximately 20 years with a normal amount of flexible pavement maintenance. Irrigation adjacent to pavements, without a deep curb or other cutoff to separate landscaping from the paving may result in premature pavement failure. Traffic parameters used for design were selected based upon engineering judgment and not upon information furnished to us such as an equivalent wheel load analysis or a traffic study.

The recommended pavement sections provided are intended as a minimum guideline and final selection of pavement cross section parameters should be made by the project civil engineer, based upon the local laws and ordinates, expected subgrade and pavement response, and desired level of conservatism. If thinner or highly variable pavement sections are constructed, increased maintenance and repair could be expected. Final pavement design should be checked by testing of soils exposed at subgrade (the upper five feet) after final grading has been completed.

Asphalt concrete and aggregate base should conform to current Caltrans Standard Specifications Section 39 and 26-1.02, respectively. As an alternative, asphalt concrete can conform to Section 203-6 of the current Standard Specifications for Public Work (Green Book). Crushed aggregate base or crushed miscellaneous base can conform to Section 200-2.2 and 200-2.4 of the Green Book, respectively. Pavement base should be compacted to at least 95 percent of the ASTM D1557 laboratory maximum dry density (modified proctor).

All pavement installation, including preparation and compaction of subgrade, compaction of base material, placement and rolling of asphaltic concrete should be done in accordance with the City of Apple Valley/County of San Bernardino specifications, and under the observation and testing of GeoTek and a City/County Inspector where required. Jurisdictional minimum compaction requirements in excess of the aforementioned minimums may govern.

Deleterious material, excessive wet or dry pockets, oversized rock fragments, and other unsuitable yielding materials encountered during grading should be removed. Once existing compacted fill are brought to the proposed pavement subgrade elevations, the subgrade should be proof-rolled in order to check for a uniform and unyielding surface. The upper 12 inches of



pavement subgrade soils should be scarified, moisture conditioned at or near optimum moisture content, and recompacted to at least 95 percent of the laboratory maximum dry density (ASTM D1557). If loose or yielding materials are encountered during construction, additional evaluation of these areas should be carried out by GeoTek. All pavement section changes should be properly transitioned.

5.7 CONCRETE FLATWORK

5.7.1 Exterior Concrete Slabs and Sidewalks

Exterior concrete slabs and sidewalks should be designed using a four (4) inch minimum thickness. No specific reinforcement is required due to the non-structural nature. However, the use of some reinforcement should be considered. Recommendations can be provided upon request. Some shrinkage and cracking of the concrete should be anticipated as a result of typical mix designs and curing practices commonly utilized in residential construction.

Sidewalks and driveways may be under the jurisdiction of the governing agency. If so, jurisdictional design and construction criteria would apply, if more restrictive than the recommendations presented herein.

Subgrade soils, classified as having "very low" expansion potential, should be pre-moistened prior to placing concrete. The subgrade soils below exterior slabs, sidewalks, driveways, etc. at the subject site should be pre-saturated to a minimum of 100% of optimum moisture content to a depth of 12 inches for "very low" expansive soils.

All concrete installation, including preparation and compaction of subgrade, should be done in accordance with City of Apple Valley/County of San Bernardino specifications, and under the observation and testing of GeoTek and a City/County Inspector, if necessary.

5.7.2 Concrete Performance

Concrete cracks should be expected. These cracks can vary from sizes that are essentially unnoticeable to more than 1/8 inch in width. Most cracks in concrete, while unsightly, do not significantly impact long-term performance. While it is possible to take measures (proper concrete mix, placement, curing, control joints, etc.) to reduce the extent and size of cracks that occur, some cracking will occur despite the best efforts to minimize it. Concrete can also undergo chemical processes that are dependent on a wide range of variables, which are difficult, at best, to control. Concrete, while seemingly a stable material, is also subject to internal expansion and contraction due to external changes over time.



One of the simplest means to control cracking is to provide weakened control joints for cracking to occur along. These do not prevent cracks from developing; they simply provide a relief point for the stresses that develop. These joints are a widely accepted means to control cracks but are not always effective. Control joints are more effective the more closely spaced they are. GeoTek suggests that control joints be placed in two directions and located a distance apart roughly equal to 24 to 36 times the slab thickness.

Exterior concrete flatwork (patios, walkways, driveways, etc.) is often some of the most visible aspects of site development. They are typically given the least level of quality control, being considered "non-structural" components. We suggest that the same standards of care be applied to these features as to the structure itself.

5.8 POST CONSTRUCTION CONSIDERATIONS

5.8.1 Landscape Maintenance and Planting

Water has been shown to weaken the inherent strength of soil, and slope stability is significantly reduced by overly wet conditions. Positive surface drainage away from graded slopes should be maintained and only the amount of irrigation necessary to sustain plant life should be provided for planted slopes. Controlling surface drainage and runoff and maintaining a suitable vegetation cover can minimize erosion. Plants selected for landscaping should be lightweight, deep-rooted types that require little water and are capable of surviving the prevailing climate.

Overwatering should be avoided. The soils should be maintained in a solid to semi-solid state as defined by the materials Atterberg Limits. Care should be taken when adding soil amendments to avoid excessive watering. Leaching as a method of soil preparation prior to planting is not recommended. An abatement program to control ground-burrowing rodents should be implemented and maintained. This is critical as burrowing rodents can decreased the long-term performance of slopes.

It is common for planting to be placed adjacent to structures in planter or lawn areas. This will result in the introduction of water into the ground adjacent to the foundation. This type of landscaping should be avoided. If used, then extreme care should be exercised with regard to the irrigation and drainage in these areas.

5.8.2 Drainage

The need to maintain proper surface drainage and subsurface systems cannot be overly emphasized. Positive site drainage should be maintained at all times. Drainage should not flow



uncontrolled down any descending slope. Water should be directed away from foundations and not allowed to pond or seep into the ground. Pad drainage should be directed toward approved areas and not be blocked by other improvements.

It is the owner's responsibility to maintain and clean drainage devices on or contiguous to their lot. In order to be effective, maintenance should be conducted on a regular and routine schedule and necessary corrections made prior to each rainy season.

5.9 PLAN REVIEW AND CONSTRUCTION OBSERVATIONS

We recommend that site foundation plans and relevant project specifications be reviewed by this office prior to construction to check for conformance with the recommendations of this report. We also recommend that GeoTek representatives be present during site grading and foundation construction to check for proper implementation of the geotechnical recommendations. The owner/developer should verify that GeoTek representatives perform at least the following duties:

- Observe site clearing and grubbing operations for proper removal of unsuitable materials.
- Observe and test bottom of removals prior to fill placement.
- Evaluate the suitability of onsite and import materials for fill placement and collect soil samples for laboratory testing where necessary.
- Observe the fill for uniformity during placement, including utility trenches.
- Perform field density testing of the fill materials.
- Observe and probe foundation excavations to confirm suitability of bearing materials.

If requested, a construction observation and compaction report can be provided by GeoTek, which can comply with the requirements of the governmental agencies having jurisdiction over the project. We recommend that these agencies be notified prior to commencement of construction so that necessary grading permits can be obtained.

6. INTENT

It is the intent of this report to aid in the design and construction of the proposed development. Implementation of the advice presented in Section 5 of this report is intended to reduce risk associated with construction projects. The professional opinions and geotechnical advice



contained in this report are not intended to imply total performance of the project or guarantee that unusual or variable conditions will not be discovered during or after construction.

The scope of our evaluation is limited to the boundaries of the subject residential lot. This review does not and should in no way be construed to encompass any areas beyond the specific area of the proposed construction as indicated to us by the client. Further, no evaluation of any existing site improvements is included. The scope is based on our understanding of the project and the client's needs, our fee estimate (P-0209421-CR) dated March 2, 2021 and geotechnical engineering standards normally used on similar projects in this region.

7. LIMITATIONS

The materials observed on the project site appear to be representative of the area; however, soil and bedrock materials vary in character between excavations and natural outcrops or conditions exposed during site construction. Site conditions may vary due to seasonal changes or other factors. GeoTek, Inc. assumes no responsibility or liability for work, testing or recommendations performed or provided by others.

Since our recommendations are based on the site conditions observed and encountered, and laboratory testing, our conclusion and recommendations are professional opinions that are limited to the extent of the available data. Observations during construction are important to allow for any change in recommendations found to be warranted. These opinions have been derived in accordance with current standards of practice and no warranty is expressed or implied. Standards of practice are subject to change with time.

8. SELECTED REFERENCES

- American Concrete Institute (ACI), 2006, Publication 302.2R-06, Guide for Concrete Slabs That Receive Moisture Sensitive Flooring Materials.
 - _____, 2010, Publications 360R-10, Guide to Design of Slabs-On-Ground.
- ASCE, 2017, "Minimum Design Loads for Buildings and Other Structures, ASCE Standard ASCE/SEI 7-16".
- ASTM, 2011, "Soil and Rock: American Society for Testing and Materials", vol. 4.08 and 4.09.



Bowles, Joseph, 1977, "Foundation Analysis and Design", Second edition.

- Bryant, W.A., and Hart, E.W., 2007, Fault Rupture Hazard Zones in California, Alquist-Priolo Earthquake Fault Zoning Act with Index to Earthquake Fault Zones Maps, California Geological Survey: Special Publication 42.
- California Code of Regulations, Title 24, 2019, Part 2 "California Building Code", 2 volumes.
- California Geological Survey (CGS, formerly referred to as the Division of Mines and Geology), 1977, "Geologic Map of California."

GeoTek, Inc., In-house proprietary information.


Roberge, P. R., 2000, "Handbook of Corrosion Engineering".


- SEA/OSHPD web service, "Seismic Design Maps" (https://seismicmaps.org).
- Southern California Earthquake Center (SCEC), 1999, Martin, G. R., and Lew, M., ed., "Recommended Procedures for Implementation of DMG Special Publication 117, Guidelines for Analyzing and Mitigating Liquefaction Hazards in California,", dated March 1999.
- State of California, California Geological Survey (CGS, formerly referred to as the California Division of Mines and Geology), 2008, "Guidelines for Evaluating and Mitigating Seismic Hazards in California," Special Publication 117A.

Terzaghi, K. and Peck, R. B., 1967, "Soil Mechanics in Engineering Practice", Second Editions.

USGS, 1973, "Geologic Map for the Lake Arrowhead Quadrangle", Dibblee T.W., Open File Report OF-74-56, scale 1:62,500.



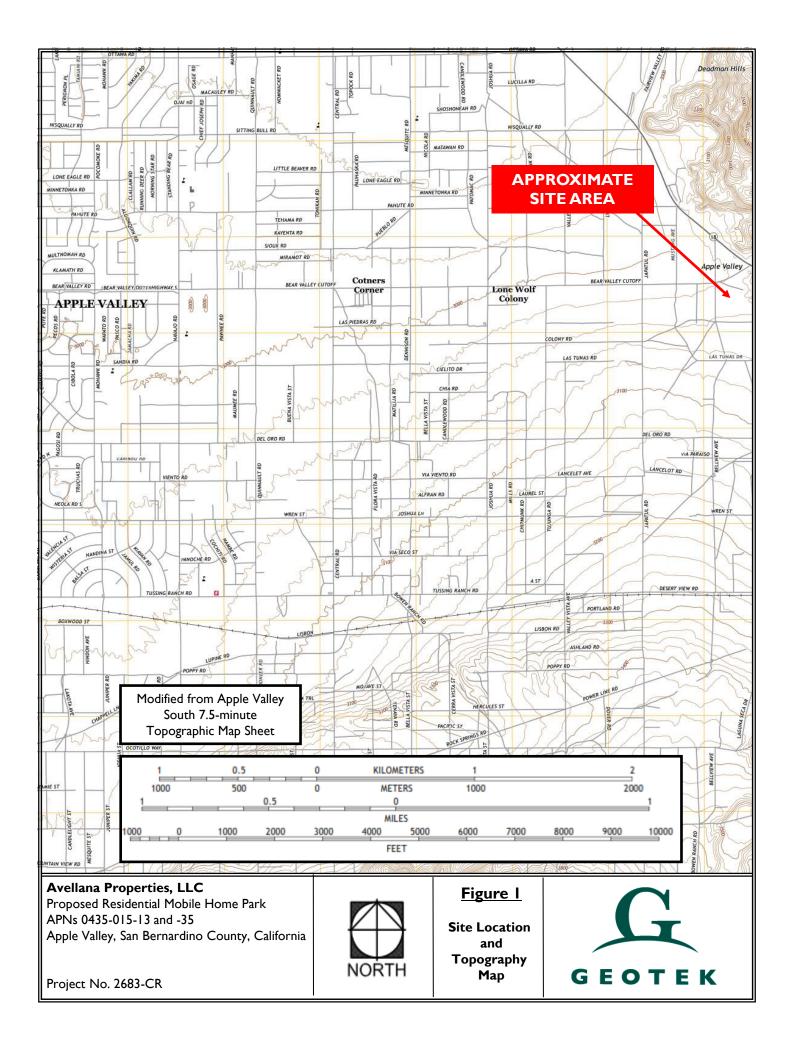

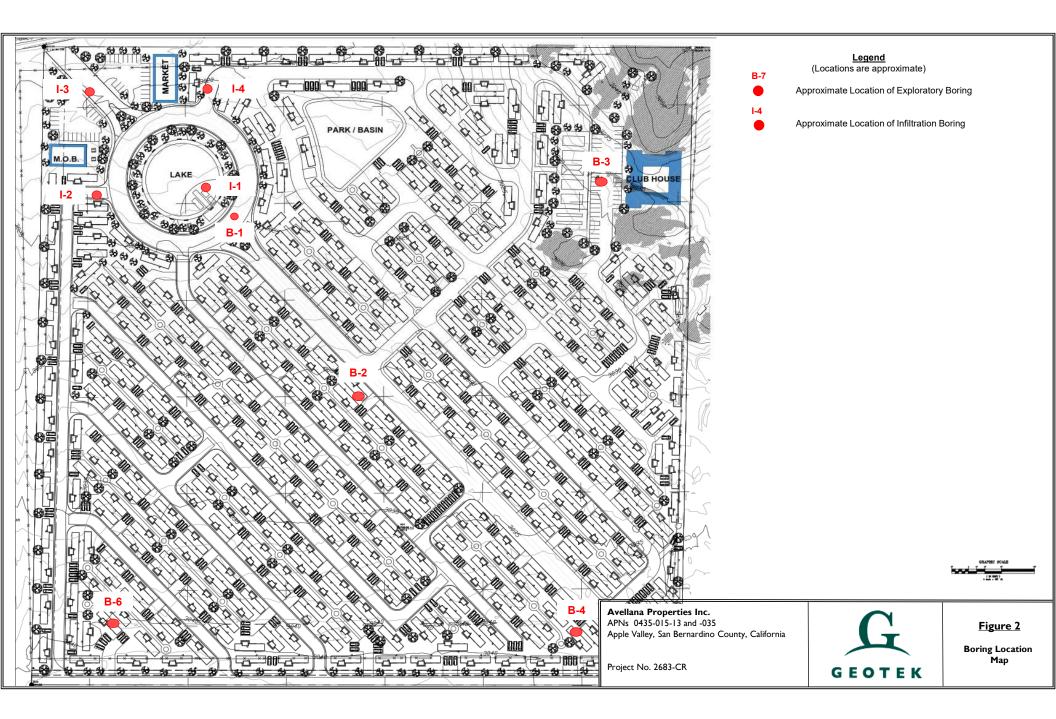

APPENDIX A

LOGS OF EXPLORATORY BORINGS

Proposed Mobile Home Park Apple Valley, San Bernardino County, California Project No. 2683-CR



A - FIELD TESTING AND SAMPLING PROCEDURES

The Modified Split-Barrel Sampler (Ring)

The ring sampler is driven into the ground in accordance with ASTM Test Method D 3550. The sampler, with an external diameter of 3.0 inches, is lined with 1-inch long, thin brass rings with inside diameters of approximately 2.4 inches. The sampler is typically driven into the ground 12 or 18 inches with a 140-pound hammer free falling from a height of 30 inches. Blow counts are recorded for every 6 inches of penetration as indicated on the log of boring. The samples are removed from the sample barrel in the brass rings, sealed, and transported to the laboratory for testing.

Bulk Samples (Large)

These samples are normally large bags of earth materials over 20 pounds in weight collected from the field by means of hand digging or exploratory cuttings.

B – BORING/TRENCH LOG LEGEND

The following abbreviations and symbols often appear in the classification and description of soil and rock on the logs of borings/trenches:

<u>SOILS</u>	
USCS	Unified Soil Classification System
f-c	Fine to coarse
f-m	Fine to medium
<u>GEOLOGIC</u>	
B: Attitudes	Bedding: strike/dip
J: Attitudes	Joint: strike/dip
C: Contact line	
	Dashed line denotes USCS material change
	Solid Line denotes unit / formational change

- Thick solid line denotes end of boring/trench

(Additional denotations and symbols are provided on the log of borings/trenches)





CLIE PROJ			Res		Properties DRILLER: 2R bbile Home Park DRILL METHOD: Hollow Stem Auger	LOGGED BY: OPERATOR:	JD Nick	
PROJ	ЕСТ	NO.:		26	3-CR HAMMER: 140 lbs/30 in.	RIG TYPE:		CME 75
LOC	ΑΤΙΟ	N:		Apple	'alley, CA	DATE:		3/8/2021
		SAMPLES	;				Labo	oratory Testing
Depth (ft)	Sample Type	Blows/ 6 in	Sample Number	USCS Symbol	BORING NO.: B-I MATERIAL DESCRIPTION AND COMMENTS	Water Content (%)	Dry Density (pcf)	Others
					Alluvium:			
-		22 27 33	RI	SM	Silty f-c SAND, gravelly, brown, slightly moist, dense	1.5	130.0	SR, El El=3
-		27 39 30	R2			3.3	111.6	Collapse
5 -		12 10 13	R3	ML	Sandy SILT, brown, slightly moist, stiff	1.7	110.9	
-		7 	R4	SM	Silty f-c SAND, brown, slightly moist, medium dense			
10-		6 12 12	R5		graveliy			
- - - - - - - - - - - - - - - - - - -		12 21	R6		dense			
20		27 18 22	R7					
-	-	29						
25					BORING TERMINATED AT 21.5 FEET No groundwater encountered Boring backfilled with soil cuttings			
	Sam	ple type	:		RingSPTSmall BulkLarge Bulk	No Recovery	<u> </u>	✓Water Table
LEGEND	Jair	ирие суре					R-Value	
LEC	Lab	testing:			arberg Limits EI = Expansion Index SA = Sieve Analysis tter/Resisitivity Test SH = Shear Test HC= Consolidation		= Maximun	



CLIE PROJ	NT: JECT N		Res		Properties obile Home Park	DRILLE DRILL METHO	OD: Hollow Stem Auger OPERATOR: Nick					
-		-			83-CR	HAMME	R:	40 lbs,/30 in.	RIG	TYPE:		CME 75
LOC	ATION	l: _		Apple \	Valley, CA	-				DATE:		3/8/2021
		SAMPLES	i								Labo	oratory Testing
Depth (ft)	Sample Type	Blows/ 6 in	Sample Number	USCS Symbol	M	BORING				Water Content (%)	Dry Density (pcf)	Others
-			ŝ			ATERIAL DESCRIPT		COMPLICITS		>		
5		30 36 46 50-6" 8 11 14 18 8 9 14 18 8 9 11	RI R2 R3 R4	SM	Alluvium: Silty f-c SAND, g medium dense	ravelly, red-brown, sligh	tly moist, v	ery dense		2.1 3.7 1.3	125.2 117.0 114.4	SH, MD, SR, EI EI=0
15		12 16 19	R6									
20		5 40 50-5"	R7	SM	Silty SAND, red-I	brown, slightly moist, ve	ry dense					SA % Passing #200 = 16.2
25		7 15 17	SI	SM	Silty f SAND, red	l-brown, slightly moist, c	lense					
30		9 3 3	S2			prown, slightly moist, ve						
LEGEND	<u>Sam</u>	ole type	;		RingSPT	Small Bulk	\ge	Large Bulk	No R	ecovery.		Water Table
B	AL = Atterberg Limits EI = Expansion Index SA = Sieve Analysis						sis	RV =	R-Value 1	Test		
Ë	Lab testing: AL = Atterberg Limits EI = Expansion Index SA = Sieve Analyst SR = Sulfate/Resistivity Test SH = Shear Test HC= Consolidation						tion	MD :	= Maximum	Density		



	ЕСТІ		Res	idential M	obile Home Park	DRILLER: DRILL METHOD:	Hollow	2R v Stem Auger	OPER	ED BY: ATOR:		JD Nick CME 75		
PROJ		-			B3-CR Valley, CA	HAMMER:	140	lbs,/30 in.	KIG	TYPE: DATE:		CME 75 3/8/2021		
LUCA				Apple	valley, CA						Lab			
Depth (ft)	Sample Type	SAMPLES u 9/swolg	Sample Number	USCS Symbol	ма	BORING NO			5	Water Content (%)	Dry Density (p.cf)	oratory Testing रा मुंच O		
_					Alluvium:									
- - - - - - - - - - - - - - - - 		16 24 23	53	SM	Silty f SAND, red-	brown, slightly moist, de	nse					SA % Passing #200 = 23.6		
40 -		28 50-5"	S4		very dense									
45 -		20 24 38	S5	SM	Silty SAND, red-b	rown, slightly moist, very	r dense					SA % Passing #200 = 15.3		
50		9 5 13	S6		medium dense	BORING TERMINAT	FD AT 5	15 FEFT						
55					No groundwater v Boring backfilled v	encountered	~ ~ ~ ~ ~ ~ ~ ~ ~ ~ ~ ~ ~ ~ ~ ~ ~ ~							
Δ	S	nlo tracci			Ring D com			Lange Dull				ا ا		
LEGEND	Sam	ple type:			RingSPT	Small Bulk	X	Large Bulk		Recovery		Water Table		
B	Lab	testing:			erberg Limits	EI = Expansion Index		SA = Sieve Anal			R-Value			
LEG	<u>Lab</u>	testing:			erberg Limits ate/Resisitivity Test	EI = Expansion Index SH = Shear Test		SA = Sieve Anal HC= Consolida			R-Value Maximun			



			Por		Properties bile Home Park	DRILLER:	2R Hollow Stem Auger		GED BY:	JD Nick	
PROJI		_	Res		3-CR	HAMMER:	140 lbs,/30 in.		G TYPE:		CME 75
LOCA		_			alley, CA				DATE:		3/8/2021
		SAMPLES								Labo	oratory Testing
Depth (ft)	Sample Type	samples ui 9 /swolg	Sample Number	USCS Symbol	MATERIA	BORING NO		TS	Water Content (%)	Dry Density (pcf)	La contraction resulting
					Alluvium:						
		18 50-4" 38	RI R2		Silty f-c SAND, red-brow	vn, slightly moist, very	r dense		2.4		disturbed sample
_		50-5"							3.2	116.7	
5		22 23 23	R3	SM/ML	Silty f SAND to sandy SIL	.T, red-brown, slightl	y moist, dense		3.5	116.8	
-		7 9 	R4	ML	Sandy SILT, gravelly, red-	brown, slightly moist	, stiff				
10		9 50-6"	R5	SM/SP	Silty c SAND to f-c SANI	D, tan-brown, slightly	moist, very dense				
_											
-					PRA	CTICAL REFUSA	L AT 12 FEET				
20					No groundwater encoun Boring backfilled with soi						
30	Sam	ple type:	:	AL = Atte				nalysis		R-Value T	
Ы.	Lab testing: AL = Atterberg Limits EI = Expansion Index SA = Sieve Analysis RV = R-Value Test SR = Sulfate/Resisitivity Test SH = Shear Test HC= Consolidation MD = Maximum Density					= Expansion Index I = Shear Test					



CLIE PROJ			Res		Properties DRILLER: 2R bile Home Park DRILL METHOD: Hollow Stem Auger	LOGGED BY: OPERATOR:	JD Nick		
PROJ	ЕСТ	NO.:		268	B-CR HAMMER: 140 lbs,/30 in.	RIG TYPE:		CME 75	
LOC	ΑΤΙΟ	N:		Apple \	alley, CA	DATE:		3/8/2021	
		SAMPLES					Lab	oratory Testing	
Depth (ft)	Sample Type	Blows/ 6 in	Sample Number	USCS Symbol	BORING NO.: B-4	Water Content (%)	Dry Density (pcf)	Others	
	0,		Sa		MATERIAL DESCRIPTION AND COMMENTS	\$	_		
		50-6"	RI	SM	Alluvium: Silty f SAND, brown, slightly moist, very dense	7.8	104.0		
5	-	16 20 26	R2		dense	2.9	122.6		
-		10 15 16	R3	SM/SP	Silty f-c SAND to f-c SAND, gravelly, brown, slightly moist, medium	dense 2.3			
-		8 16 18	R4						
10- 		10 13 21	R5	SP	F-c SAND, tan-brown, slightly moist, medium dense				
- 5 - - - - -		6 20 25	R6		dense				
20 -		18 50-6"	R7	SM	Silty f-c SAND, red-brown, slightly moist, very dense BORING TERMINATED AT 21 FEET				
25					No groundwater encountered Boring backfilled with soil cuttings				
LEGEND		ple type	:		-RingSPTSmall BulkLarge Bulk rberg Limits EI = Expansion Index SA = Sieve Analy	No Recovery sis RV =	R-Value	∑Water Table	
	Lab testing: ALE Address g Lines Lines SA = Jeter Analysis NV = NV and SR = Sulfate/Resistivity Test SH = Shear Test HC= Consolidation MD = Maxim						= Maximun	n Density	



CLIE PROJ			Res		Properties bbile Home Park D	DRILLER:	2R Hollow Stem Auger	LOGGED BY	-	JD Nick
PRO	ЕСТ І	NO.:		268	3-CR	HAMMER:	140 lbs,/30 in.	RIG TYPE	-	CME 75
LOC	ΑΤΙΟΙ	N:		Apple \	′alley, CA			DATE		3/8/2021
		SAMPLES							Lab	oratory Testing
Depth (ft)	Sample Type	Blows/ 6 in	Sample Number	USCS Symbol	MATERIA		D.: B-5	Vater Content (%)	Dry Density (pcf)	Others
			ŝ			L DESCRIPTION		3 >		
		22 27 33 27 39 30	RI R2	SM	<u>Alluvium:</u> Silty f-c SAND, red-browi	n, moist, dense		5.1	126.9	
5 -	/\ -	12 10 13	R3	SM	Silty f SAND, brown, moi:	st, medium dense		5.5	122.4	
-		7 	R4	SP	f-c SAND, tan-brown, slig	htly moist, medium o	lense			
10-		6 12 12	R5	SM/SP	Silty f-c SAND to f-c SAN	ID, tan-brown, slight	y moist, dense			
15		2 2 27	R6	SP	f-c SAND, tan-brown, slig	htly moist, dense				
20		18 22 29	R7	SM/ML	Silty f SAND to Sandy SIL	T, brown, moist, der NG TERMINATED				
25					No groundwater encount Boring backfilled with soil					
30 -	Sam		:		RingSPT	Small Bulk	SA = Sieve Ana	Iysis RV		∑Water Table
ш	Lab	testing:								
LEGEND	Sample type: Ring SPT Small Bulk Large Bulk No Recovery Water Lab testing: AL = Atterberg Limits SR = Sulfate/Resistivity Test EI = Expansion Index SH = Shear Test SA = Sieve Analysis RV = R-Value Test		Test							



	ECT I		Res	idential M	Properties bile Home Park	DRILLER:	2R Hollow Stem Auger	LOGGED B	ł:	JD Nick
-	IECT I				3-CR	HAMMER:	140 lbs,/30 in.	RIG TYP		CME 75 3/8/2021
LOC		_		Арріе у	alley, CA			DAT		
Depth (ft)	Sample Type	SAMPLES	Sample Number	USCS Symbol	MATER		D.: B-6 AND COMMENTS	Water Content	isity	oratory Testing
			•,		Alluvium:			-		
		19 22 27 22 30 34	RI R2	SM	Silty f-c SAND, red-bro	wn, slightly moist, den	se	2.4 5.9	119.1	Collapse
-		7 2 4	R3 SM/SP Silty f-c SAND to f-c SAND, gravelly, brown, slightly moist, medium dense					dense I.7		
-		8 15 24	R4	SM/ML	Silty f SAND to Sandy S	SILT, gravelly, red-brov	vn, slightly moist, dense	2		
10-		 8 25	R5							
- 5 - -		7 6	R6	SM/SP	Silty f-c SAND, pebbly,	tan-brown, slightly mo	ist, medium dense			
20	-	8 16 30	R7	ML	Sandy SILT, red-brown,					
25					BOF		2 A1 21.3 FEET			
30 -										
Q	Sam	ple type:		-	RingSPT	Small Bulk	Large Bulk	No Recover	y	
LEGEND	Lak	4 a a 4 i		AL = Att	erberg Limits	EI = Expansion Index	SA = Sieve Analy	sis R'	= R-Value	Test
LE	Lab	testing:				SH = Shear Test	HC= Consolidat) = Maximur	



			Resid		Properties obile Home Park	DRILLER:	2R Hollow Stem Auger	LOGGED BY: OPERATOR:	JD Nick
	ЈЕСТ І				B3-CR	HAMMER:	140 lbs,/30 in.	RIG TYPE:	CME 75
	ATIO				Valley, CA	· · · · · -		DATE:	3/8/2021
		SAMPLES							Laboratory Testing
Depth (ft)	Sample Type	Blows/ 6 in	Sample Number	USCS Symbol	ма	BORING N		Water Content (%)	Dry Density (p.cf) Others
_			ŝ		Alluvium:	TERIAL DESCRIPTION	AND COMMENTS	>	
5				SM		bly, brown, slightly moist BORING TERMINATI	ED AT 5 FFFT		
-	_					BORING TERMINATI	ED AT S FEET		
10-					Boring backfilled	with soil cuttings			
30-	+								
:									
<u>P</u>	Sam	ple type:			RingSPT	Small Bulk	Large Bulk	No Recovery	
LEGEND					erberg Limits	EI = Expansion Index	SA = Sieve Analy	vsis RV =	R-Value Test
Ľ	∟aD	testing:			ate/Resisitivity Test	SH = Shear Test	HC= Consolida		= Maximum Density



			Resid		Properties obile Home Park	DRILLER:	2R Hollow Stem Auger	LOGGED BY: OPERATOR:	
	JECT				B3-CR	HAMMER:	140 lbs,/30 in.	RIG TYPE:	
	ATIO				Valley, CA	- '		DATE:	
		SAMPLES				-			Laboratory Testing
Depth (ft)	Sample Type	Blows/ 6 in	Sample Number	USCS Symbol	ма	BORING N		Water Content (%)	Dry Density (p.cf) Others
			ŝ		Alluvium:	ATERIAL DESCRIPTION	AND COMPLETE	>	
5				SM		bbly, brown, slightly moist BORING TERMINAT	ED AT 5 FEET		
-	-					Boland Fearmar			
10					Boring backfilled	with soil cuttings			
30-	-								
:									
₽	Sam	ple type:			RingSPT	Small Bulk	Large Bulk	No Recovery	⊥Water Table
LEGEND					erberg Limits	EI = Expansion Index	SA = Sieve Anal		R-Value Test
Ë	Lab	testing:			ate/Resisitivity Test	SH = Shear Test	HC= Consolida		= Maximum Density



			Resid		Properties obile Home Park	DRILLER:	2R Hollow Stem Auger	LOGGED BY: OPERATOR:	
	ЈЕСТ І				B3-CR	HAMMER:	140 lbs,/30 in.	RIG TYPE:	
	ΑΤΙΟΙ				Valley, CA	· · · · · -		DATE:	3/8/2021
		SAMPLES							Laboratory Testing
Depth (ft)	Sample Type	Blows/ 6 in	Sample Number	USCS Symbol	ма	BORING N		Water Content (%)	Dry Density (p.cf) Others
_			ŝ		Alluvium:	TERIAL DESCRIPTION	AND COMMENTS	>	
-				SM		bly, brown, slightly moist BORING TERMINATI			
-						BORING TERMINATI	EDAISFEET		
10 					Boring backfilled	with soil cuttings			
30 -	-								
-									
LEGEND	Sam	ple type:			RingSPT	Small Bulk	Large Bulk	No Recovery	↓Water Table
LEG	Lab	testing:			erberg Limits ate/Resisitivity Test	EI = Expansion Index SH = Shear Test	SA = Sieve Anal HC= Consolida		· R-Value Test = Maximum Density



			Resid		Properties obile Home Park	DRILLER:	2R Hollow Stem Auger	LOGGED BY: OPERATOR:	JD Nick
	ЈЕСТ І				B3-CR	HAMMER:	140 lbs,/30 in.	RIG TYPE:	CME 75
	ATIO				Valley, CA			DATE:	3/8/2021
		SAMPLES	[-	-			Laboratory Testing
Depth (ft)	Sample Type	Blows/ 6 in	Sample Number	USCS Symbol	MA	BORING N		Water Content (%)	Dry Density (p-cf) Others
			ŝ		Alluvium:	CIERCAE DESCRIPTION		, ,	
5				SM		bly, brown, slightly moist			
						BORING TERMINAT	ED AT 5 FEET		
10					No groundwater Boring backfilled				
30-									
1									
-	-								
LEGEND	Sam	ple type:			RingSPT	Small Bulk	Large Bulk	No Recovery	⊥Water Table
ü	امل	tostina		AL = Att	erberg Limits	EI = Expansion Index	SA = Sieve Anal	vsis RV =	R-Value Test
Щ		testing:		SR = Sulf	ate/Resisitivity Test	SH = Shear Test	HC= Consolida	tion MD =	= Maximum Density

APPENDIX B

LABORATORY TEST RESULTS

Proposed Mobile Home Park Apple Valley, San Bernardino County, California Project No. 2683-CR



SUMMARY OF LABORATORY TESTING

Classification

Soils were classified visually in general accordance with the Unified Soil Classification System (ASTM Test Method D 2487). The soil classifications by GeoTek are shown on the logs of exploratory borings in Appendix B.

Consolidation/Collapse

Consolidation and collapse testing was performed on selected samples of the site soils according to ASTM Test Method D 4546. The results of this testing are presented in Appendix B.

Direct Shear

Shear testing was performed in a direct shear machine of the strain-control type in general accordance with ASTM Test Method D 3080. The rate of deformation is approximately 0.035 inch per minute. The samples were sheared under varying confining loads in order to determine the coulomb shear strength parameters, angle of internal friction and cohesion. The results of the testing are presented in Appendix B.

Expansion Index

Expansion Index testing was performed on one representative soil sample. Testing was performed in general accordance with ASTM Test Method D 4829. The results of the testing is provided below.

Boring No.	Depth (ft.)	Soil Type	Expansion Index	Classification
B-I	0-5	Silty Sand	3	Very Low
B-2	0-5	Silty Sand	0	Very Low

Moisture-Density Relationship


Laboratory testing was performed on representative site samples collected during the recent subsurface exploration. The laboratory maximum dry density and optimum moisture content for the samples tested were determined in general accordance with test method ASTM Test Procedure D 1557. The results are included in Appendix B.


Sulfate Content, Resistivity and Chloride Content

Testing to determine the water-soluble sulfate content, resistivity testing and the chloride content was performed by others. The results of the testing are provided below and in Appendix B.

Boring No.	Depth (ft.)	pH ASTM G51	Chloride ASTM D4327 (ppm)	Sulfate ASTM D4327 (% by weight)	Resistivity ASTM G187 (ohm-cm)
B-1	0-5	7.7	30.2	0.0039	5,561
B-2	0-5	7.9	16.8	0.0022	14,070




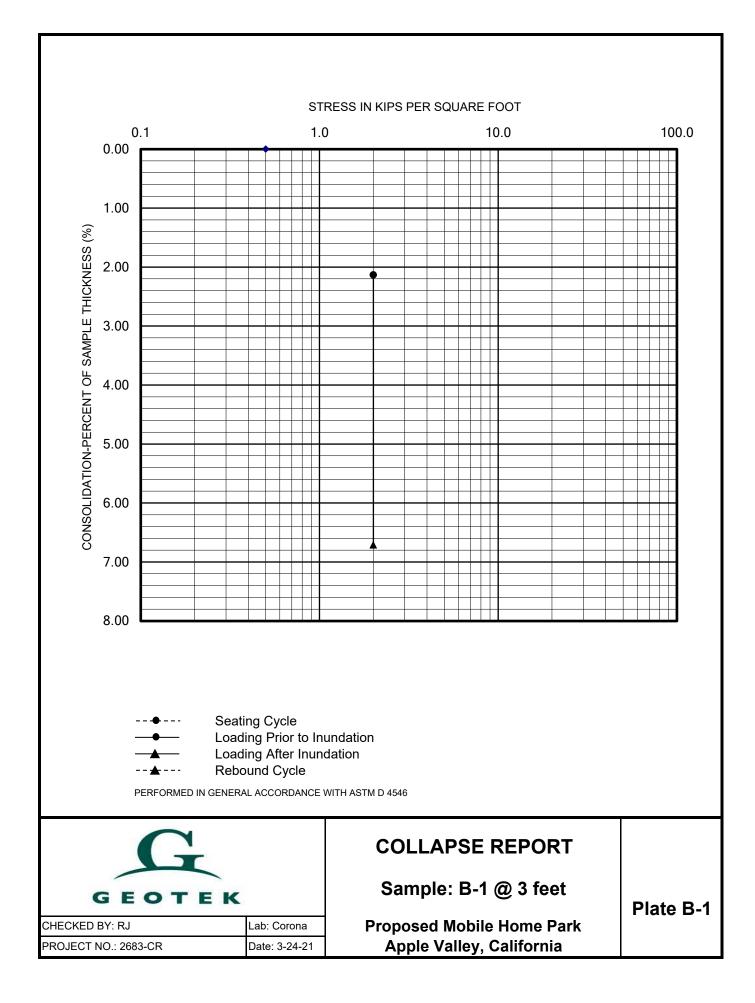

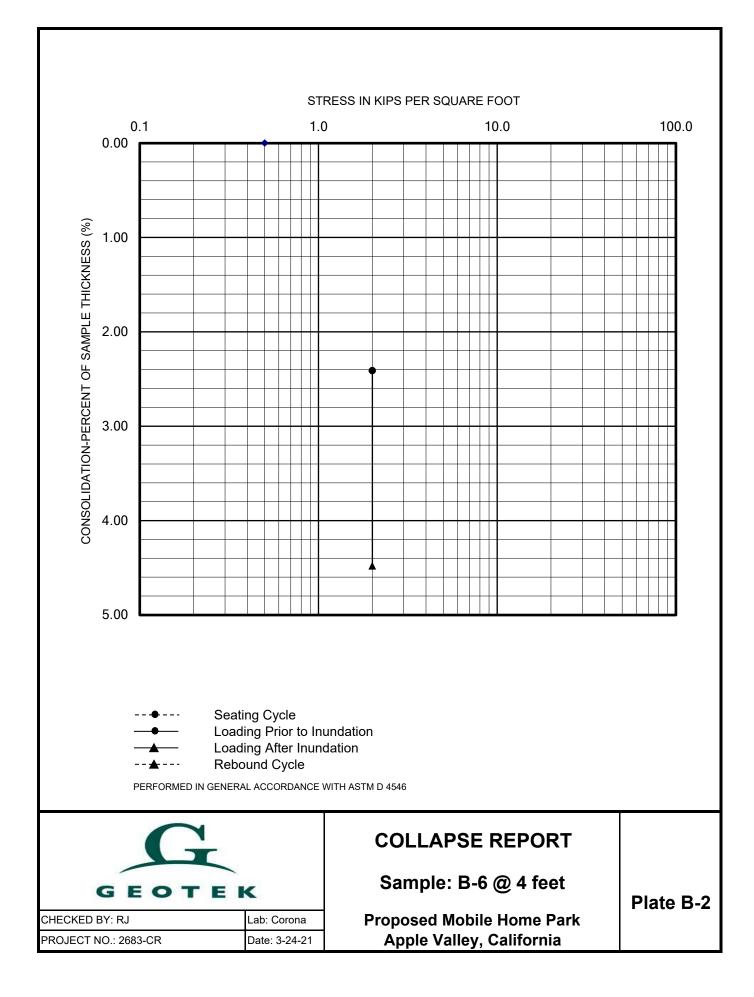



DIRECT SHEAR TEST

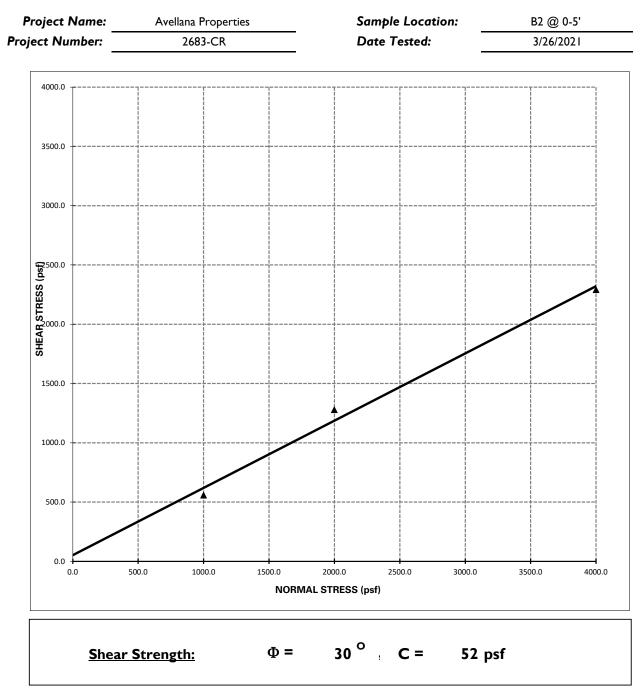


Notes: I - The soil specimen used in the shear box was a ring sample remolded to approximately 90% relative compaction from a bulk sample collected during the field investigation.

- 2 The above reflect direct shear strength at saturated conditions.
- 3 The tests were run at a shear rate of 0.035 in/min.




MOISTURE/DENSITY RELATIONSHIP

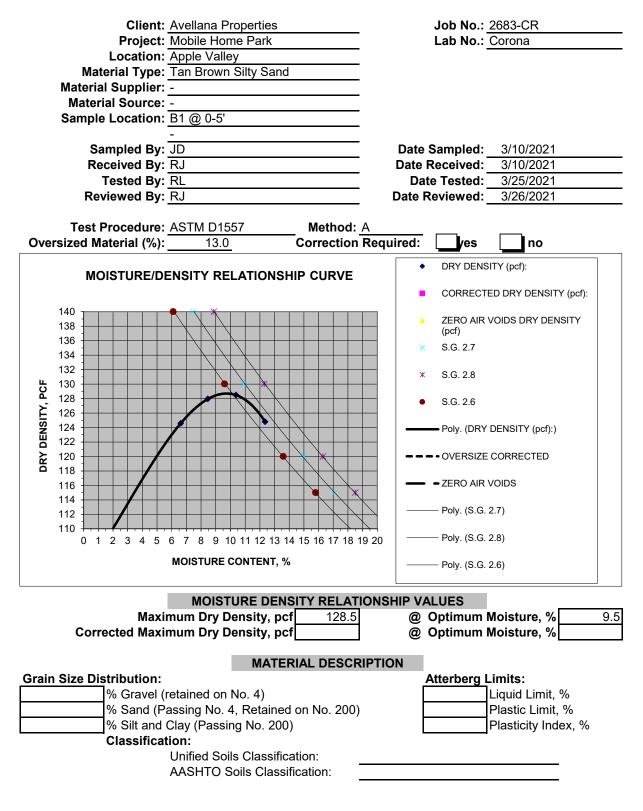



MOISTURE/DENSITY RELATIONSHIP

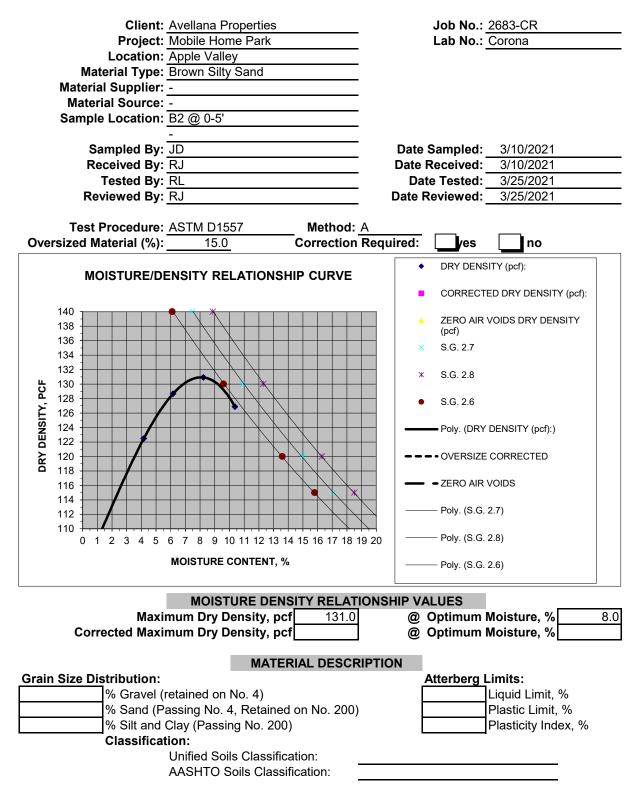



Results Only Soil Testing for Mobile Home Park

March 29, 2021

Prepared for: Anna Scott GeoTek, Inc. 1548 North Maple Street Corona, CA 92280 ascott@geotekusa.com

Project X Job#: S210326C Client Job or PO#: 2683-CR

Respectfully Submitted,

Eduardo Hernandez, M.Sc., P.E. Sr. Corrosion Consultant NACE Corrosion Technologist #16592 Professional Engineer California No. M37102 ehernandez@projectxcorrosion.com



Project X Corrosion Engineering Corrosion Control – Soil, Water, Metallurgy Testing Lab

Soil Analysis Lab Results

Client: GeoTek, Inc. Job Name: Mobile Home Park Client Job Number: 2683-CR Project X Job Number: S210326C March 29, 2021

	Method	MTSA	W	MLSV		ATA	V	MTSA	MTSA	SM 4500-	MLSA	MLSA	ASTM	MLSA	MTSA	ASTM	MTSA	MTSA	ASTM
		D4327	27	D4325	-	G187	7	D4972	G200	S2-D	D4327	D6919	D6919	D6919	D6919	D6919	D6919	D4327	D4327
Bore# / Description	Depth	Sulfates	ites	Chlorides	des	Resistiv	istivity	ЬH	Redox	Sulfide	Nitrate	Ammonium I	Lithium	Sodium	Potassium 1	Magnesium	Calcium	Fluoride	Fluoride Phosphate
		SO4 ²⁻	2	C'		As Rec'd M	finimum			S^{2}	NO ³	NH4 ⁺	Ľ,	\mathbf{Na}^+	К [±]	Mg^{2+}	ca^{2+}	$F_2^{}$	PO_4^{3-}
	(i)	(mg/kg)	(mg/kg) (wt%) (mg/kg) (wt%) (Ohm-cm)	(mg/kg)	(wt%)		(Ohm-cm)		(mV)	(mg/kg)	(mg/kg)	(mg/kg)	(mg/kg)	(mg/kg)	(mg/kg)	(mg/kg)	(mg/kg)	(mg/kg)	(mg/kg)
2683-CR B-1 @	0-5	39.0	39.0 0.0039 30.2 0.0030 28,140	30.2	0.0030	28,140	5,561	7.7	155	<0.01	10.9	21.5	0.01	59.7	5.2	28.0	137.8	1.8	15.3
2683-CR B-2 @	0-5	22.0 0.0022 16.8 0.0017 40,870	0.0022	16.8	0.0017	40,870	14,070	7.9	160	<0.01	6.3	8.4	QN	30.3	3.9	7.2	29.7	0.9	14.3

Cations and Anions, except Sulfide and Bicarbonate, tested with Ion Chromatography mg/kg = milligrams per kilogram (parts per million) of dry soil weight ND = 0 = Not Detected | NT = Not Tested | Unk = Unknown Chemical Analysis performed on 1:3 Soil-To-Water extract

APPENDIX C

INFILTRATION TEST DATA

Proposed Mobile Home Facility Apple Valley, San Bernardino County, California Project No. 2683-CR



PERCOLATION DATA SHEET

APN 0435-01	5-13 \$-0	235		
Project: MOBILE HOME	PARK		Job No.: Z	683-CR
Test Hole No.: <u>B-1</u>	Tested By:	DVG		11/2021
Depth of Hole As Drilled: 60	Before Test:	60	After Test:	60

	Reading No.	Time	Time Interval (Min)	Total Depth of Hole (Inches)	Initial Water Level (Inches)	Final Water Level (Inches)	∆ In Water Level (Inches)	Comments
-								PRESOAK 5 GAL
								3/10/2021
-		831		60	_ZØ			BEGIN 3/11/2021
		856	25			10 1/4	9 3/4	IST Z5 MIN.
_		858		60	20			
		923	25			10 3/4	9 1/4	ZND 25 MIN.
_		925		60	20			BEGIN
		955	30			914	10 3/4	IST 30 MIN.
_		<u>957</u>		60	20			
		1027	30			91/4	10 3/4	ZNO 30 MIN.
_		1029		60	20			
		1059	30			91/2	10 1/2	3RD 30 MIN.
		1101		60	20			
		1131	30			91/2	10 1/2	4 TH 30 MON.
		1133		60	20			
		1203	30			91/2	10 1/2	STA 30 MINI.
		1205		60	20			
		1235	30			93/4	10 1/4	6TH 30 MIN.
		1237		60	20			
		107	30			9 3/4	10 1/4	7 TH 30 MIN.

APN 0435-015	-13 & -0.		
Project: MOBILE HOME	PARK		Job No.:
Test Hole No.: <u>B-1</u>	Tested By: _	DVG	
Depth of Hole As Drilled:60	Before Test:	60	After Test: <u>60</u> .

٠

Reading No.	Time	Time Interval (Min)	Total Depth of Hole (Inches)	Initial Water Level (Inches)	Final Water Level (Inches)	∆ in Water Levei (Inches)	Comments
	109		60	ZO			
	139	30			9 3/4	10 1/4	BTH 30 MIN.
	<u>141</u>		60	20			
	211	30			10	10	9774 30 MIN.
	213		60	20			
	243	30			10	10	10TH 30 MIN.
	245		60	20			
	315	30			101/4	9 3/4	11TH 30 MIN.
	317		60	20			
	347	30			1014	9 3/4	12TH 30 MIN.
	_						

APN 0435-015	-13 \$ -035	E1
Project: MOBILE HOME	PARK	Job No.: 2683-CR
Test Hole No.: <u>B-2</u>	Tested By:D	VG
Depth of Hole As Drilled:60	Before Test: 60.	After Test: 60

•

Reading No.	Time	Time Interval (Min)	Total Depth of Hole (Inches)	Initial Water Level (Inches)	Final Water Level (Inches)	∆ In Water Level (Inches)	Comments
							PRESOAK 5 GAL
							3/10/2021
	<u>838</u>		60	20			BEGIN 3/11/202)
	903	25			10	10	IST 25 MIN.
	905		60	20			
	930	25			10	10	ZNO 25 MIN.
	<u>932</u>		60	Zo			
	1002	30			81/4	11 1/4	IST 30 MIN.
	1004		60	20			
	1034	30			8 3/4	11 1/4	ZND 30 MIN.
	<u>1036</u>		60	20			
	1106	30			9	11	3RD 30 MIN.
	1108		60	20			
	1138	30			9	11	4 TH 30 MAN.
	1140		60	20			
	1210	30			91/4	10 3/4	5TH 30 MIN.
	1212		60	20			
	1242	30			91/4	10 3/4	6TH 30 MIN.
	1244		60	20			
	114	30			91/2	10 1/2	7774 30 MIN.

P	ER	C	0	LA	T	0	N	DA	TA	SH	EET	•

•

APN 0435-015	-13 ¢-	-035	
Project: MOBILE HOME P	ARK		Job No.: _2683-CR.
Test Hole No.: <u>B-Z</u>	Tested By:	DVG	Date: 3/10, 11/2021
Depth of Hole As Drilled:60 ··	Before Test:	60	After Test: 60

Reading No.	Time	Time Interval (Min)	Total Depth of Hoie (inches)	Initial Water Level (Inches)	Final Water Level (Inches)	∆ in Water Levei (inches)	Comments
	116		60	_20_			
	146	30			91/2	10 1/2	BTH 30 MIN.
	148		60	_20			
	218	30			9 3/4	10 1/4	9TH 30 MIN.
	220		60	20			
	250	30	or the state and a state of the state		9 3/4	10 1/4	IOTH 30 MIN.
	252		60	20			
	322	30			10	10	11 TH 30 MIN.
	<u>324</u>		60	20			
	354	30			10	10	12 TH 30 MIN.
			,		<u> </u>		

PERCOLATION DATA SHEET

2

APN 0435-015-13 \$	-035	
Project: MOBILE HOME PARK		Job No.: 2683-CR
Test Hole No.: <u>3-3</u> Tested By:		Date: 3/10,11/2021
Depth of Hole As Drilled: 60" Before Test:	60	After Test:60 ``

Reading No.	Time	Time Interval (Min)	Total Depth of Hole (Inches)	Initial Water Level (Inches)	Final Water Level (Inches)	∆ In Water Level (Inches)	Rate (minutes per inch)	Comments
	817		60	20				
	84z	z5			9 1/4	103/4		IST 25 MIN.
	844		60	20				
	909	z 5			9 3/4	10/4		ZND 25 MIN.
	911		60	20				
	941	30			8	12		Ist 30 MIN.
	<u>943</u>		60	20				
	1013	30			8	12		ZNO 30 MIN.
	1015		60	20				
	1045	30			81/4	11 3/4		3RD 30 MIN.
	1047		60	20				
	1117	30			81/2	11/2		ATT 30 MIN.
	<u>1119</u>		60	20				
	1149	30			8 3/4	11 1/4		5TH 30 MAN.
	<u>//5/</u>		60	20				
	1221	30			9	11		GTH 30 MIN.
	<u>1223</u>		60	20				
	1253	30			9	11		7 TH 30 MIN.

PERCOLATION DATA SHEET

Depth of Hole As Drilled:	60"	Before Test:	60	After Test: 60
Test Hole No.: 3-3		Tested By:	DVG	, Date: 3/10, 11/2021
Project: MOBILE	HOME	PARK		_, Job No.: 2683-CR
HPN O	435-0	15-13	\$-035	

Reading No.	Time	Time Interval (Min)	Total Depth of Hole (Inches)	Initial Water Level (Inches)	Final Water Level (Inches)	∆ In Water Level (Inches)	Rate (minutes per inch)	Comments
	1255		60	20				
	125	30			9	11		BTH 30 MIN.
	127		60	20				
	157	30			9 1/4	10 3/4		9 TH 30 MIN.
	<u>159</u>		60	_20				
	229	30			91/2	1012		IOTH 30 MIN.
	<u> 231</u>		60	_20				
	301	30			91/2	101/2		11TH 30 MIN.
	303		60	20				
	333	30			91/2	10 1/2		1277 30 MIN.

APN 042-	
APN 0435-015-13 \$ -035	
Project: MOBILE HOME PARK	
Test Hole No. B-A	Job No.: 2683-CR
Depth of Hole As Drilled: 60 Before Town (1997)	Date: 3/10, 11/2021
Before Test: 60°	After Test: 60

Reading No.	Time	Time Interval (Min)	Total Depth of Hole (Inches)	Initial Water Level (Inches)	Final Water Level (Inches)	∆ In Water Level (Inches)	Rate (minutes per inch)	Comments
	=							PRESOAK 5 GAL
	824							3/10/2021
	849		_60	_ <u></u> 20				BEGIN 3/11/2021
		25			9 3/4	101/4		IST 25 MIN.
	851		60	_Z0				
	916	25			10	10		ZND 25 MIN.
	918		60	ZO				-10 -3 M/R.
	948	30			81/4	11 3/4		
	950		60	20	014	1174		IST 30 MIN.
	1020	30			81/2			
	IOZZ				012	11/2		2ND 30 MIN.
			60	_20_				
	105Z	30			8/2	11 1/2		3RD 30 MIN.
	1054		_60	_20				
	1124	30			8 3/4	11 1/4		4 TH 30 MIN.
	1126		60	20				
	1156	30			9			5174 30 MIN.
	1158		60	ZO	· · ·			VIH COMM.
	1228	30			9			6TH 30 MIN.
	1230		60	20	·	,,		
	100	30			91/4	10 3/4		TTHE 30 MIN.

TT. CUEET

APX 0435	-015-13 \$-0	35	
Project: MOBILE	HOME PARK		Job No.: 2683-2R
Test Hole No.: <u>B-4</u>	Tested By:	DVG	Date: 3/10, 11/2021.
Depth of Hole As Drilled:	60 Before Test:	60	After Test: 60

Reading No.	Time	Time Interval (Min)	Total Depth of Hole (Inches)	Initial Water Level (Inches)	Final Water Level (Inches)	∆ In Water Level (Inches)	Rate (minutes per inch)	Comments
	102		60	20				
	132	30			914	10 3/4		Bry 30 MIN.
	<u>134</u>		60	_ 20				
	204	30			91/2	10 1/2		9774 30 MIN.
	206		60	_20				
	236	30			91/2	10 1/2		10TH 30 MIN.
	<u>238</u>		60	20				
	308	30			93/4	10 1/4		1/ TH 30 MIN.
	310		60	_Z0				
	340	30			9 3/4	10'14		12 TH 30 MIN.

Client:	Avellana Properties, Inc.
Project:	Apple Valley
Project No:	2683-CR
Date:	3/10/2011

Boring No.

I-1

Percolation Rate (Porchet Method)

Time Interval, ∆t =	30
Final Depth to Water, D _F =	49.75
Test Hole Radius, r =	4
Initial Depth to Water, D _O =	40
Total Test Hole Depth, $D_T =$	60

Equation -	$I_t =$	∆H (60r)
		$\Delta t (r+2H_{avg})$
$H_O = D_T - D_O =$		20
$H_F = D_T - D_F =$		10.25
$\Delta H = \Delta D = H_{O} - H_{F}$	=	9.75
$Havg = (H_O + H_F)/2 =$	=	15.125

I _t =	2.28	Inches per Hour
------------------	------	-----------------



Client:	Avellana Properties, Inc. Apple Valley 2683-CR	
Project:		
Project No:		
Date:	3/10/2011	

Boring No.

I-2

Percolation Rate (Porchet Method)

30
50
4
40
60

Equation -	$I_t =$	∆H (60r)
		$\Delta t (r+2H_{avg})$
$H_0 = D_T - D_0 =$		20
$H_F = D_T - D_F =$		10
$\Delta H = \Delta D = H_{O} - H_{F} =$		10
$Havg = (H_O + H_F)/2 =$		15

I _t = 2.35 Inches per Hour

_



Client:	Avellana Properties, Inc.
Project:	Apple Valley
Project No:	2683-CR
Date:	3/10/2011

Boring No.

I-3

Percolation Rate (Porchet Method)

Time Interval, Δt =	30
Final Depth to Water, D _F =	50.5
Test Hole Radius, r =	4
Initial Depth to Water, D _O =	40
Total Test Hole Depth, $D_T =$	60
Test Hole Radius, r = Initial Depth to Water, D _O =	4 40

Equation -	$I_t =$	∆H (60r)
		$\Delta t (r+2H_{avg})$
$H_0 = D_T - D_0 =$		20
$H_F = D_T - D_F =$		9.5
$\Delta H = \Delta D = H_{O} - H_{F}$	=	10.5
$Havg = (H_O + H_F)/2$	=	14.75

$I_t = 2.51$ Inches	s per Hour
---------------------	------------

_



Client:	Avellana Properties, Inc.		
Project:	Apple Valley		
Project No:	2683-CR		
Date:	3/10/2011		

Boring No.

I-4

Percolation Rate (Porchet Method)

Time Interval, ∆t =	30
Final Depth to Water, D _F =	50.25
Test Hole Radius, r =	4
Initial Depth to Water, D _O =	40
Total Test Hole Depth, $D_T =$	60

Equation -	$I_t =$	∆H (60r)
		$\Delta t (r+2H_{avg})$
$H_0 = D_T - D_0 =$		20
$H_F = D_T - D_F =$		9.75
$\Delta H = \Delta D = H_{O} - H_{F}$	=	10.25
$Havg = (H_O + H_F)/2$	=	14.875

I _t =	2.43	Inches per Hour
------------------	------	-----------------

_




APPENDIX D

SEISMIC SETTLEMENT ANALYSIS

Proposed Mobile Home Park Apple Valley, San Bernardino County, California Project No. 2683-CR



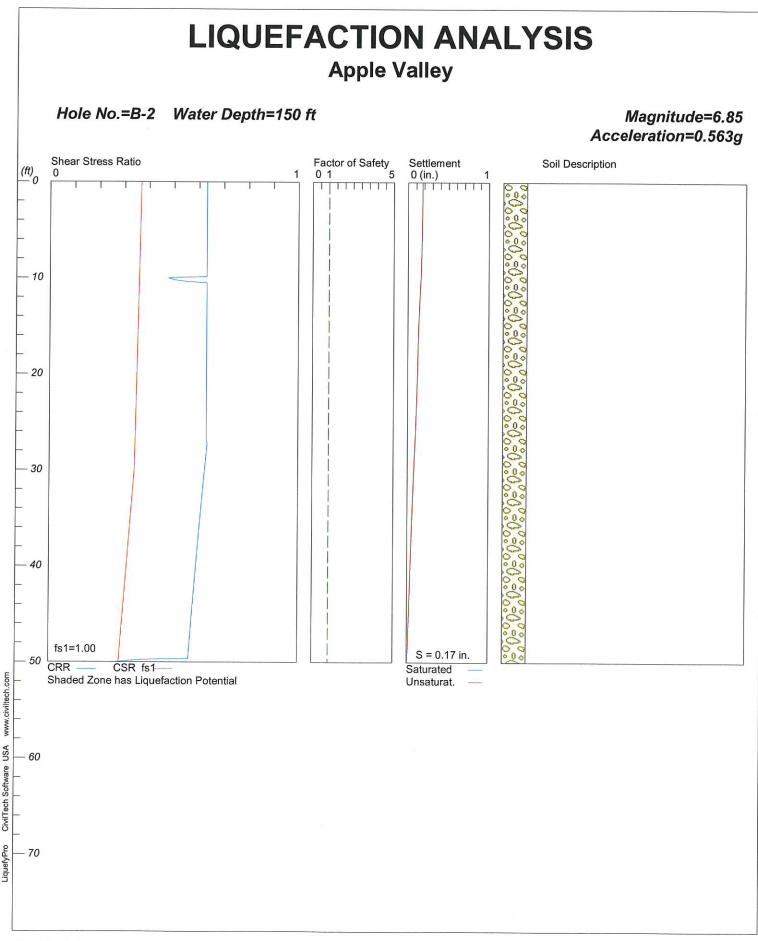

****** LIQUEFACTION ANALYSIS SUMMARY Copyright by CivilTech Software www.civiltech.com ***** Font: Courier New, Regular, Size 8 is recommended for this report. Licensed to , 3/26/2021 10:37:32 AM Input File Name: UNTITLED Title: Apple Valley Subtitle: 2683-CR Surface Elev.= Hole No.=B-2 Depth of Hole= 50.00 ft Water Table during Earthquake= 150.00 ft Water Table during In-Situ Testing= 150.00 ft Max. Acceleration= 0.56 g Earthquake Magnitude= 6.85 Input Data: Surface Elev.= Hole No.=B-2 Depth of Hole=50.00 ft Water Table during Earthquake= 150.00 ft Water Table during In-Situ Testing= 150.00 ft Max. Acceleration=0.56 g Earthquake Magnitude=6.85 No-Liquefiable Soils: CL, OL are Non-Liq. Soil 1. SPT or BPT Calculation. 2. Settlement Analysis Method: Ishihara / Yoshimine 3. Fines Correction for Liquefaction: Idriss/Seed 4. Fine Correction for Settlement: During Liquefaction* 5. Settlement Calculation in: All zones* 6. Hammer Energy Ratio, Ce = 1.257. Borehole Diameter, Cb= 1.15 8. Sampling Method, Cs = 1.29. User request factor of safety (apply to CSR) , User= 1 Plot one CSR curve (fs1=User) 10. Use Curve Smoothing: Yes* * Recommended Options In-Situ Test Data: Depth SPT gamma Fines

ft		pcf	%
0.00	53.00	120.00	15.00
5.00	16.00	120.00	15.00
8.00	21.00	120.00	15.00
10.00	13.00	120.00	15.00
15.00	22.00	120.00	15.00
18.00	58.00	120.00	16.20
23.00	32.00	120.00	15.00
28.00	26.00	120.00	50.00
33.00	47.00	120.00	23.60
38.00	100.00	120.00	23.60
43.00	62.00	120.00	15.30
48.00	61.00	120.00	15.30
50.00	18.00	120.00	15.30

Output Results:

Settlement of Saturated Sands=0.00 in. Settlement of Unsaturated Sands=0.17 in. Total Settlement of Saturated and Unsaturated Sands=0.17 in. Differential Settlement=0.087 to 0.115 in.

Depth ft	CRRm	CSRfs	F.S.	S_sat. in.	S_dry in.	S_all in.
0.00	0.63	0.37	5.00	0.00	0.17	0.17
1.00	0.63	0.37	5.00	0.00	0.17	0.17
2.00	0.63	0.36	5.00	0.00	0.17	0.17
3.00	0.63	0.36	5.00	0.00	0.17	0.17
4.00	0.63	0.36	5.00	0.00	0.17	0.17
5.00	0.63	0.36	5.00	0.00	0.17	0.17
6.00	0.63	0.36	5.00	0.00	0.17	0.17
7.00	0.63	0.36	5.00	0.00	0.17	0.17
8.00	0.63	0.36	5.00	0.00	0.16	0.16
9.00	0.63	0.36	5.00	0.00	0.16	0.16
10.00	0.47	0.36	5.00	0.00	0.16	0.16
11.00	0.63	0.36	5.00	0.00	0.15	0.15
12.00	0.63	0.36	5.00	0.00	0.14	0.14
13.00	0.63	0.35	5.00	0.00	0.14	0.14
14.00	0.63	0.35	5.00	0.00	0.13	0.13
15.00	0.63	0.35	5.00	0.00	0.13	0.13
16.00	0.63	0.35	5.00	0.00	0.13	0.13
17.00	0.63	0.35	5.00	0.00	0.12	0.12
18.00	0.63	0.35	5.00	0.00	0.12	0.12
19.00	0.63	0.35	5.00	0.00	0.12	0.12
20.00	0.63	0.35	5.00	0.00	0.12	0.12
21.00	0.63	0.35	5.00	0.00	0.11	0.11
22.00	0.63	0.35	5.00	0.00	0.11	0.11
23.00	0.63	0.35	5.00	0.00	0.11	0.11

24.00	0.63	0.35	5.00	0.00	0.10	0.10
25.00	0.63	0.34	5.00	0.00	0.10	0.10
26.00	0.63	0.34	5.00	0.00	0.09	0.09
27.00	0.63	0.34	5.00	0.00	0.09	0.09
28.00	0.63	0.34	5.00	0.00	0.08	0.08
29.00	0.63	0.34	5.00	0.00	0.08	0.08
30.00	0.62	0.34	5.00	0.00	0.08	0.08
31,00	0.62	0.34	5.00	0.00	0.07	0.07
32.00	0.62	0.33	5.00	0.00	0.07	0.07
33.00	0.61	0.33	5.00	0.00	0.06	0.06
34.00	0.61	0.33	5.00	0.00	0.06	0.06
35.00	0.61	0.33	5.00	0.00	0.06	0.06
36.00	0.60	0.32	5.00	0.00	0.05	0.05
37.00	0.60	0.32 🕤	5.00	0.00	0.05	0.05
38.00	0.60	0.32	5.00	0.00	0.05	0.05
39.00	0.59	0.31	5.00	0.00	0.04	0.04
40.00	0.59	0.31	5.00	0.00	0.04	0.04
41.00	0.59	0.31	5.00	0.00	0.04	0.04
42.00	0.58	0.30	5.00	0.00	0.03	0.03
43.00	0.58	0.30	5.00	0.00	0.03	0.03
44.00	0.58	0.30	5.00	0.00	0.03	0.03
45.00	0.58	0.30	5.00	0.00	0.02	0.02
46.00	0.57	0.29	5.00	0.00	0.02	0.02
47.00	0.57	0.29	5.00	0.00	0.02	0.02
48.00	0.57	0.29	5.00	0.00	0.01	0.01
49.00	0.56	0.28	5.00	0.00	0.01	0.01
50.00	0.27	0,28	5.00	0.00	0.00	0.00

* F.S.<1, Liquefaction Potential Zone (F.S. is limited to 5, CRR is limited to 2, CSR is limited to 2)

Units: Unit: qc, fs, Stress or Pressure = atm (1.0581tsf); Unit Weight = pcf; Depth = ft; Settlement = in.

1 a	atm (atmospher	re) = 1 tsf (ton/ft2)
CRF	Rm	Cyclic resistance ratio from soils
CSF	Rsf	Cyclic stress ratio induced by a given earthquake (with user
request fac	ctor of safety	
F.9	5.	Factor of Safety against liquefaction, F.S.=CRRm/CSRsf
S_ <u>s</u>		Settlement from saturated sands
S_0	1ry	Settlement from Unsaturated Sands
S_a	all	Total Settlement from Saturated and Unsaturated Sands
NoL	Liq	No-Liquefy Soils

APPENDIX E

GENERAL GRADING GUIDELINES

Proposed Mobile Home Park Apple Valley, San Bernardino County, California Project No. 2683-CR



GENERAL GRADING GUIDELINES

Guidelines presented herein are intended to address general construction procedures for earthwork construction. Specific situations and conditions often arise which cannot reasonably be discussed in general guidelines, when anticipated these are discussed in the text of the report. Often unanticipated conditions are encountered which may necessitate modification or changes to these guidelines. It is our hope that these will assist the contractor to more efficiently complete the project by providing a reasonable understanding of the procedures that would be expected during earthwork and the testing and observation used to evaluate those procedures.

General

Grading should be performed to at least the minimum requirements of governing agencies, Chapters 18 and 33 of the Uniform Building Code, CBC and the guidelines presented below.

Preconstruction Meeting

A preconstruction meeting should be held prior to site earthwork. Any questions the contractor has regarding our recommendations, general site conditions, apparent discrepancies between reported and actual conditions and/or differences in procedures the contractor intends to use should be brought up at that meeting. The contractor (including the main onsite representative) should review our report and these guidelines in advance of the meeting. Any comments the contractor may have regarding these guidelines should be brought up at that meeting.

Grading Observation and Testing

- I. Observation of the fill placement should be provided by our representative during grading. Verbal communication during the course of each day will be used to inform the contractor of test results. The contractor should receive a copy of the "Daily Field Report" indicating results of field density tests that day. If our representative does not provide the contractor with these reports, our office should be notified.
- 2. Testing and observation procedures are, by their nature, specific to the work or area observed and location of the tests taken, variability may occur in other locations. The contractor is responsible for the uniformity of the grading operations; our observations and test results are intended to evaluate the contractor's overall level of efforts during grading. The contractor's personnel are the only individuals participating in all aspect of site work. Compaction testing and observation should not be considered as relieving the contractor's responsibility to properly compact the fill.
- 3. Cleanouts, processed ground to receive fill, key excavations, and subdrains should be observed by our representative prior to placing any fill. It will be the contractor's responsibility to notify our representative or office when such areas are ready for observation.



- 4. Density tests may be made on the surface material to receive fill, as considered warranted by this firm.
- 5. In general, density tests would be made at maximum intervals of two feet of fill height or every 1,000 cubic yards of fill placed. Criteria will vary depending on soil conditions and size of the fill. More frequent testing may be performed. In any case, an adequate number of field density tests should be made to evaluate the required compaction and moisture content is generally being obtained.
- 6. Laboratory testing to support field test procedures will be performed, as considered warranted, based on conditions encountered (e.g. change of material sources, types, etc.) Every effort will be made to process samples in the laboratory as quickly as possible and in progress construction projects are our first priority. However, laboratory workloads may cause in delays and some soils may require a **minimum of 48 to 72 hours to complete test procedures**. Whenever possible, our representative(s) should be informed in advance of operational changes that might result in different source areas for materials.
- 7. Procedures for testing of fill slopes are as follows:
 - a) Density tests should be taken periodically during grading on the flat surface of the fill, three to five feet horizontally from the face of the slope.
 - b) If a method other than over building and cutting back to the compacted core is to be employed, slope compaction testing during construction should include testing the outer six inches to three feet in the slope face to determine if the required compaction is being achieved.
- 8. Finish grade testing of slopes and pad surfaces should be performed after construction is complete.

Site Clearing

- I. All vegetation, and other deleterious materials, should be removed from the site. If material is not immediately removed from the site it should be stockpiled in a designated area(s) well outside of all current work areas and delineated with flagging or other means. Site clearing should be performed in advance of any grading in a specific area.
- 2. Efforts should be made by the contractor to remove all organic or other deleterious material from the fill, as even the most diligent efforts may result in the incorporation of some materials. This is especially important when grading is occurring near the natural grade. All equipment operators should be aware of these efforts. Laborers may be required as root pickers.
- 3. Nonorganic debris or concrete may be placed in deeper fill areas provided the procedures used are observed and found acceptable by our representative.



Treatment of Existing Ground

- I. Following site clearing, all surficial deposits of alluvium and colluvium as well as weathered or creep effected bedrock, should be removed unless otherwise specifically indicated in the text of this report.
- 2. In some cases, removal may be recommended to a specified depth (e.g. flat sites where partial alluvial removals may be sufficient). The contractor should not exceed these depths unless directed otherwise by our representative.
- 3. Groundwater existing in alluvial areas may make excavation difficult. Deeper removals than indicated in the text of the report may be necessary due to saturation during winter months.
- 4. Subsequent to removals, the natural ground should be processed to a depth of six inches, moistened to near optimum moisture conditions and compacted to fill standards.
- 5. Exploratory back hoe or dozer trenches still remaining after site removal should be excavated and filled with compacted fill if they can be located.

Fill Placement

- I. Unless otherwise indicated, all site soil and bedrock may be reused for compacted fill; however, some special processing or handling may be required (see text of report).
- 2. Material used in the compacting process should be evenly spread, moisture conditioned, processed, and compacted in thin lifts six (6) to eight (8) inches in compacted thickness to obtain a uniformly dense layer. The fill should be placed and compacted on a nearly horizontal plane, unless otherwise found acceptable by our representative.
- 3. If the moisture content or relative density varies from that recommended by this firm, the contractor should rework the fill until it is in accordance with the following:
 - a) Moisture content of the fill should be at or above optimum moisture. Moisture should be evenly distributed without wet and dry pockets. Pre-watering of cut or removal areas should be considered in addition to watering during fill placement, particularly in clay or dry surficial soils. The ability of the contractor to obtain the proper moisture content will control production rates.
 - b) Each six-inch layer should be compacted to at least 90 percent of the maximum dry density in compliance with the testing method specified by the controlling governmental agency. In most cases, the testing method is ASTM Test Designation D 1557.
- 4. Rock fragments less than eight inches in diameter may be utilized in the fill, provided:
 - a) They are not placed in concentrated pockets;
 - b) There is a sufficient percentage of fine-grained material to surround the rocks;
 - c) The distribution of the rocks is observed by, and acceptable to, our representative.



- 5. Rocks exceeding eight (8) inches in diameter should be taken off site, broken into smaller fragments, or placed in accordance with recommendations of this firm in areas designated suitable for rock disposal. On projects where significant large quantities of oversized materials are anticipated, alternate guidelines for placement may be included. If significant oversize materials are encountered during construction, these guidelines should be requested.
- 6. In clay soil, dry or large chunks or blocks are common. If in excess of eight (8) inches minimum dimension, then they are considered as oversized. Sheepsfoot compactors or other suitable methods should be used to break up blocks. When dry, they should be moisture conditioned to provide a uniform condition with the surrounding fill.

Slope Construction

- 1. The contractor should obtain a minimum relative compaction of 90 percent out to the finished slope face of fill slopes. This may be achieved by either overbuilding the slope and cutting back to the compacted core, or by direct compaction of the slope face with suitable equipment.
- 2. Slopes trimmed to the compacted core should be overbuilt by at least three (3) feet with compaction efforts out to the edge of the false slope. Failure to properly compact the outer edge results in trimming not exposing the compacted core and additional compaction after trimming may be necessary.
- 3. If fill slopes are built "at grade" using direct compaction methods, then the slope construction should be performed so that a constant gradient is maintained throughout construction. Soil should not be "spilled" over the slope face nor should slopes be "pushed out" to obtain grades. Compaction equipment should compact each lift along the immediate top of slope. Slopes should be back rolled or otherwise compacted at approximately every 4 feet vertically as the slope is built.
- 4. Corners and bends in slopes should have special attention during construction as these are the most difficult areas to obtain proper compaction.
- 5. Cut slopes should be cut to the finished surface. Excessive undercutting and smoothing of the face with fill may necessitate stabilization.

UTILITY TRENCH CONSTRUCTION AND BACKFILL

Utility trench excavation and backfill is the contractors responsibility. The geotechnical consultant typically provides periodic observation and testing of these operations. While efforts are made to make sufficient observations and tests to verify that the contractors' methods and procedures are adequate to achieve proper compaction, it is typically impractical to observe all backfill procedures. As such, it is critical that the contractor use consistent backfill procedures.



Compaction methods vary for trench compaction and experience indicates many methods can be successful. However, procedures that "worked" on previous projects may or may not prove effective on a given site. The contractor(s) should outline the procedures proposed, so that we may discuss them **prior** to construction. We will offer comments based on our knowledge of site conditions and experience.

- Utility trench backfill in slopes, structural areas, in streets and beneath flat work or hardscape should be brought to at least optimum moisture and compacted to at least 90 percent of the laboratory standard. Soil should be moisture conditioned prior to placing in the trench.
- 2. Flooding and jetting are not typically recommended or acceptable for native soils. Flooding or jetting may be used with select sand having a Sand Equivalent (SE) of 30 or higher. This is typically limited to the following uses:
 - a) shallow (12 + inches) under slab interior trenches and,
 - b) as bedding in pipe zone.

The water should be allowed to dissipate prior to pouring slabs or completing trench compaction.

- 3. Care should be taken not to place soils at high moisture content within the upper three feet of the trench backfill in street areas, as overly wet soils may impact subgrade preparation. Moisture may be reduced to 2% below optimum moisture in areas to be paved within the upper three feet below sub grade.
- 4. Sand backfill should not be allowed in exterior trenches adjacent to and within an area extending below a 1:1 projection from the outside bottom edge of a footing, unless it is similar to the surrounding soil.
- 5. Trench compaction testing is generally at the discretion of the geotechnical consultant. Testing frequency will be based on trench depth and the contractors procedures. A probing rod would be used to assess the consistency of compaction between tested areas and untested areas. If zones are found that are considered less compact than other areas, this would be brought to the contractors attention.

<u>JOB SAFETY</u>

General

Personnel safety is a primary concern on all job sites. The following summaries are safety considerations for use by all our employees on multi-employer construction sites. On ground personnel are at highest risk of injury and possible fatality on grading construction projects. The company recognizes that construction activities will vary on each site and that job site safety is the contractor's responsibility. However, it is, imperative that all personnel be safety conscious to avoid accidents and potential injury.



In an effort to minimize risks associated with geotechnical testing and observation, the following precautions are to be implemented for the safety of our field personnel on grading and construction projects.

- I. Safety Meetings: Our field personnel are directed to attend the contractor's regularly scheduled safety meetings.
- 2. Safety Vests: Safety vests are provided for and are to be worn by our personnel while on the job site.
- 3. Safety Flags: Safety flags are provided to our field technicians; one is to be affixed to the vehicle when on site, the other is to be placed atop the spoil pile on all test pits.

In the event that the contractor's representative observes any of our personnel not following the above, we request that it be brought to the attention of our office.

Test Pits Location, Orientation and Clearance

The technician is responsible for selecting test pit locations. The primary concern is the technician's safety. However, it is necessary to take sufficient tests at various locations to obtain a representative sampling of the fill. As such, efforts will be made to coordinate locations with the grading contractors authorized representatives (e.g. dump man, operator, supervisor, grade checker, etc.), and to select locations following or behind the established traffic pattern, preferably outside of current traffic. The contractors authorized representative should direct excavation of the pit and safety during the test period. Again, safety is the paramount concern.


Test pits should be excavated so that the spoil pile is placed away from oncoming traffic. The technician's vehicle is to be placed next to the test pit, opposite the spoil pile. This necessitates that the fill be maintained in a drivable condition. Alternatively, the contractor may opt to park a piece of equipment in front of test pits, particularly in small fill areas or those with limited access.

A zone of non-encroachment should be established for all test pits (see diagram below). No grading equipment should enter this zone during the test procedure. The zone should extend outward to the sides approximately 50 feet from the center of the test pit and 100 feet in the direction of traffic flow. This zone is established both for safety and to avoid excessive ground vibration, which typically decreases test results.



Apple Valley, San Bernardino County, California

TEST PIT SAFETY PLAN

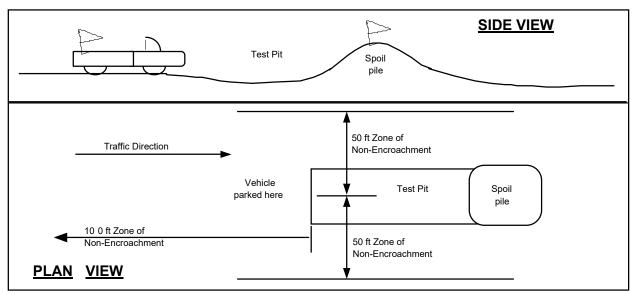

Slope Tests

When taking slope tests, the technician should park their vehicle directly above or below the test location on the slope. The contractor's representative should effectively keep all equipment at a safe operation distance (e.g. 50 feet) away from the slope during testing.

The technician is directed to withdraw from the active portion of the fill as soon as possible following testing. The technician's vehicle should be parked at the perimeter of the fill in a highly visible location.

Trench Safety

It is the contractor's responsibility to provide safe access into trenches where compaction testing is needed. Trenches for all utilities should be excavated in accordance with CAL-OSHA and any other applicable safety standards. Safe conditions will be required to enable compaction testing of the trench backfill.

All utility trench excavations in excess of 5 feet deep, which a person enters, are to be shored or laid back. Trench access should be provided in accordance with OSHA standards. Our personnel are directed not to enter any trench by being lowered or "riding down" on the equipment.

Our personnel are directed not to enter any excavation which;

- I. is 5 feet or deeper unless shored or laid back,
- 2. exit points or ladders are not provided,
- 3. displays any evidence of instability, has any loose rock or other debris which could fall into the trench, or
- 4. displays any other evidence of any unsafe conditions regardless of depth.



If the contractor fails to provide safe access to trenches for compaction testing, our company policy requires that the soil technician withdraws and notifies their supervisor. The contractors representative will then be contacted in an effort to effect a solution. All backfill not tested due to safety concerns or other reasons is subject to reprocessing and/or removal.

Procedures

In the event that the technician's safety is jeopardized or compromised as a result of the contractor's failure to comply with any of the above, the technician is directed to inform both the developer's and contractor's representatives. If the condition is not rectified, the technician is required, by company policy, to immediately withdraw and notify their supervisor. The contractor's representative will then be contacted in an effort to effect a solution. No further testing will be performed until the situation is rectified. Any fill placed in the interim can be considered unacceptable and subject to reprocessing, recompaction or removal.

In the event that the soil technician does not comply with the above or other established safety guidelines, we request that the contractor bring this to technicians attention and notify our project manager or office. Effective communication and coordination between the contractors' representative and the field technician(s) is strongly encouraged in order to implement the above safety program and safety in general.

The safety procedures outlined above should be discussed at the contractor's safety meetings. This will serve to inform and remind equipment operators of these safety procedures particularly the zone of non-encroachment.

The safety procedures outlined above should be discussed at the contractor's safety meetings. This will serve to inform and remind equipment operators of these safety procedures particularly the zone of non-encroachment.

